Form 3160-3 (December 1990)

UNITEC TATES

SUBMIT IN TRIPLI (See other instructions

reverse side)

Form approved.

CISP

	BUREAU OF LAN	IDIVANAGEMENT		5.LEASE D	ESIGNATION AND SERIAL	NO.	
APPLICATION FOR PERMIT TO DRILL OR DEEPEN					LC 029426-B 6.IF INDIAN, ALLOTTEE OR TRIBE NAME		
				6.IF INDIA	N, ALLOTTEE OR TRIBE N	AME	
la TYPE OF WORK:	DRILL	DEEPEN 🔀		7.UNIT AC	REEMENT NAME	-	
h TYPE OF WELL:	GAS D ON THE	SINGLE	MULTIPLE				
WELL L	well Other negro	ZONE	ZONE	8.FARM O	R LEASE NAME, WELL NO.		
2 NAME OF OPERAT	DEVON ENERGY OPERA	TING CORPORATION			st "B" #32		
3. ADDRESS AND TE				9.API WEL	*		
		2 1500, OKC, OK 73102 (40		30-015-2 10.FIELD	5954 AND POOL, OR WILDCAT		
	L (Report location clearly and in ac FSL and 660' FWL of Section 9	cordance with any State requireme	ents) *	Gravbur	g/Jackson	-	
At surface 1980	PSD and 600 F WD of Section 9			11.SEC.,T.,	R.,M.,OR BLOCK AND SUR	VEY OR AREA	
At top proposed prod. 2	zone (SAME)			Sec. 10-1	7S-31E		
14.DISTANCE IN MILES ANI	DIRECTION FROM NEAREST TOWN OR	POST OFFICE*		12. COUN	TY OR PARISH	13. STATE	
Approximately 5 miles I	NE of Loco Hills, NM			Eddy		NM	
15.DISTANCE FROM PROPO		16.NO. OF ACRES IN LEASE	VELCEIME!	137	17.NO. OF ACRES ASS	SIGNED	
PROPERTY OR LEASE L		1919.88	NE Serve	Sanday .	TO THIS WELL		
(Also to nearest drlg, unit line 18.DISTANCE FROM PROPO		19.PROPOSED DEPTH			20.ROTARY OR CABL	E TOOLS*	
TO NEAREST WELL, DRI OR APPLIED FOR, ON TI	LLING, COMPLETED,	4100'	JAN 3 1 1383		Rotary		
21.ELEVATIONS (Show wheth			· · · · · · · · · · · · · · · · · · ·	22. A	PPROX. DATE WORK WILL	START*	
GL 3900'		æ	dil com. D	Jan	1, 1996		
		6					
23.		PROPOSED CASING AND CEN					
SIZE OF HOLE	GRADE, SIZE OF CASING	WEIGHT PER FOOT	SETTING DEPTH		QUANTITY OF	CEMENT	
12-1/4" 7-7/8"	J-55 8-5/8"	24#			450 sxs cmt		
7-118	J-55 5-1/2"	15.5#	3934		160 sxs cmt.		
w/60,000 XL + 120 f/3314-19' w/2000 g Hcl, Frac'd w/25,0 Proposed: Deepen 2-3/8" plastic coate An application to C required to perform IN ABOVE SPACE DES 8 to drill or deepen direct	Perfs: 3314-3754' (62), 21,000# sd. Acid f/3451-3484' gals 15% NEFE acid. Fracion gals 30# gel + 40,000 # 20 well to approximately 4100 sd tubing and a Baker Tensiconvert to an injection well in this work. Please see attackers.	w/2000 gals 15% NEFE a 2d 3314-3484' w/40,000 XI 0/40 sand. '. Proposed interval of inter	cid. Acid f/3391-3424 L gel & 100,000# 20/40 Ajection: 3150-140' 5'. filed with the O.D. North Market North M	o addition	als 15% NEFE ac f/2186-2379, w/40 onal surface area v osed new productive zoo preventer program, if a	id. Acid 00 gals 15% vill be ne. If proposal	
	ral or State office use)	TITLE Engineer	ring Technician DA	TE	1.71.45	<u>.</u>	
, ,	•						
Application approval does n	not warrant or certify that the applicant ROVAL, IF ANY:	holds legal or equitable title to those ri	ights in the subject lease which we	ould entitle t	he applicant to conduct op	erations thereon.	
APPROVED BY	ORIG. SCD.) JOE G. I	ARA TITLE PET	ROLEUM ENGINE	E DA	те <u>1/29/90</u>	<u> </u>	

See Instructions On Reverse Side

DEVON ENERGY OPERATING CORPORATION

HYDROGEN SULFIDE DRILLING OPERATIONS PLAN

MECEIVED IN 98

A. Hydrogen Sulfide Training

All rig crews and company personnel will receive training from a qualified instructor in the following areas prior to penetrating any hydrogen sulfide bearing formations during drilling operations:

- 1. The hazards and characteristics of hydrogen sulfide (H2S).
- 2. The proper use and maintenance of the H2S safety equipment and of personal protective equipment to be utilized at the location such as H2S detection monitors, alarms and warning systems, and breathing equipment. Briefing areas and evacuation procedures will also be discussed and established.
- 3. Proper rescue techniques and procedures will be discussed and established.

In addition to the above, supervisory personnel will be trained in the prevention of oil and gas well blowouts in accordance with Minerals Management Service Standards Subpart - 0 - 250 - 212.

Prior to penetrating any known H2S bearing formation, all rig crews and company personnel will be required to have received appropriate H2S training course and have certification of such training. All contract personnel employed on an unscheduled basis will be required to have received appropriate H2S training.

This Hydrogen Sulfide Drilling And Operations Plan shall be available at the wellsite during drilling operations.

B. H2S Safety Equipment And Systems

All H2S safety equipment and systems will be installed, tested, and operational when drilling operations reaches a depth approximately 500' above any known or probable H2S bearing formation. The safety systems to be utilized during drilling operations are as follows:

1. Well Control Equipment

- (a) Double ram BOP with a properly sized pipe rams to accommodate all pipe sizes in use.
- 2. H2S Detection And Monitoring Equipment
 - (a) Two (2) H2S detection monitors will be placed in service at the location. One monitor will be placed on the rig floor and, one will be at the working mud pits. This monitoring system will have warning lights and audible alarms that will alert personnel when H2S levels reach 20 ppm.
 - (b) One (1) Sensidyne Pump with the appropriate detection tubes will also be available to perform spot checks for H2S concentrations in any remote or isolated areas.
- 3. Protective Equipment For Essential Personnel

Protective equipment will consist of the following:

- (a) One (1) five minute escape pack will be available for the rig's derrick man.
- (b) Two (2) thirty minute rescue packs to be located at the designated briefing areas.
- 4. Visual Warning System

Visual warning system will consist of the following:

- (a) Two wind direction indicators.
- (b) One condition / warning sign which will be posted on the road providing direct access to the location. The sign will contain lettering of sufficient size to be readable at a reasonable distance from the immediate location. The sign will inform the public that a hydrogen sulfide gas environment could be encountered be at the location.

5. Mud Program

(a) The mud program has been designed to minimize the volume of H2S circulated to surface. Proper mud weight and safe drilling practices (for example, keeping the hole filled during trips) will minimize hazards when drilling in H2S bearing formations.

6. Metallurgy


(a) All drill strings, casings, tubing, wellhead, blowout preventers, drilling spools, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.

7. Communication

(a) Two way radio and cellular telephone communication will be available in company vehicles.

C. Diagram Of Drilling Location

1. Attached is a diagram representing a typical location layout as well as the location of H2S monitors, briefing areas, and wind direction indicators.

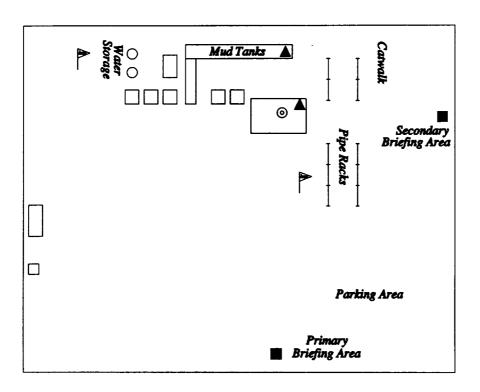

H2S MONITORS WITH ALARMS AT THE RIG FLOOR, AND STEEL MUD PITS WIND DIRECTION INDICATORS

SAFE BRIEFING AREAS WITH CAUTION SIGNS AND PROTECTIVE BREATHING EQUIPMENT

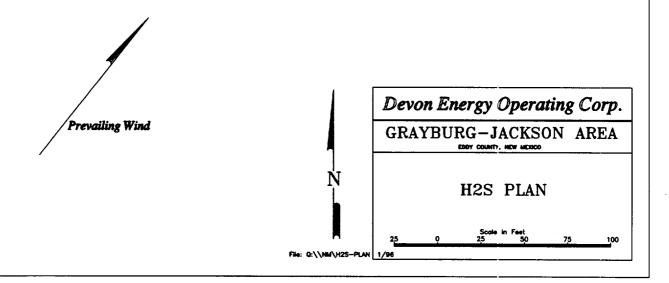


EXHIBIT 1

MINIMUM BLOWOUT PREVENTER REQUIREMENTS 3000 psi Working Pressure

3 MWP

STACK REQUIREMENTS

No.	ltem	Min. I.D.	Min. Nominal
1	Stripping head		
2	Two single or one dual hydraulically operated rams		
3	Tubing head W/2-2" outlets		
4	2" min. kill line and 3" min. choke line outlets in ram. (alternate to 3 above)		
5	Valve Gate □	2"	
6	Valve Gate Plug	2ª	
7	Casing head		~
8	Valve Gate ☐	1-13/16"	
9	Pressure gage with needle valve	,	

STRIPPING HEAD BLIND RAMS PIPE RAMS TUBING HEAD CASING HEAD 9

CASING

(8)

(7

CONFIGURATION A

OPTIONAL

10	Flanged valve	1-13/16	
----	---------------	---------	--

MEC TO FURNISH

- 1. Bradenhead or casinghead and side valves.
- 2. Wear bushing, if required.

GENERAL NOTES

- 1. Deviations from this drawing may be made only with the express permission of MEC's Drilling manager.
- All connections, valves, fittings, plping, etc., subject to well pump pressure must have minimum working pressure of preventers up through choke. Valves must be full opening and suitable for high pressure mud service.
- Controls to be of standard design and each marked, showing opening and closing position.
- 4. All valves to be equipped with handwheels or handles ready for immediate use.
- 5. Choke lines must be suitably anchored.
- 6. Handwheels and extensions to be connected and ready for use.
- 7. All seamless steel control piping (3000 psi working pressure) to have flexible joints to avoid stress. Hoses will be permitted.
- 8. Casinghead connections shall not be used except in case of emergency.

H. E. WEST "A" & "B" WATERFLOOD EXPANSION

Deepening Wells Prior to Conversion

Devon Energy Operating Corporation plans to deepen the subject wells utilizing a completion unit in conjunction with a reverse circulating unit. A standard 3000 psi working pressure double ram BOP with a stripping head will be utilized. Since all wells proposed for deepening have casing set and are cemented below 2500', a conventional choke manifold is not needed. The BOP and stripping head have the capability of controlling flow while drilling and / or shutting the well in.

All drilling fluids will be contained in steel pits. No reserve pit will be needed. All proposed work will be contained on the original pad with no disturbance to the surrounding area.

The drilling mud program will be a 9.0 ppg - 10.0 ppg brine water. This should be sufficient weight to allow circulation of drilling fluids to the surface while at the same time controlling the reservoir pressures customary for this area.