

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires July 31, 1996

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

Oil Cons.
N.M. DIV-Dist. 2
801 W. Grand Avenue
Artesia, NM 88210

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
BURNETT OIL CO., INC. /

3a. Address BURNETT PLAZA- SUITE 1500
801 CHERRY STREET UNIT#9 FORT WORTH TX 76102-6881 817/332-5108

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UNIT O, 330' FSL, 1650' FEL, SEC 13, T17S, R30E

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

JACKSON A #19

9. API Well No.

30-015-31669

10. Field and Pool, or Exploratory Area

CEDAR LAKE YESO

11. County or Parish, State



Eddy County, N.M.

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other <u>RUN CASING</u>
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

5/08/01 Ran 11 JTS 8 5/8" 24# J55 R3 ST&C new casing set @ 488.41' w/notched Texas pattern shoe, w/float valve in first collar & centralizers on btm. five joints, btm three joints thread locked. BJ pumped 150 sks Class "H" w/10% thixotropic cement & 1% CaCl & 1/4#/sk. Cello flake. Tail w/320 sks. Class "C" w/2% CaCl. Bump plug 10:15AM, cement did not circulate to surface. Job witnessed by Gene Hunt-BLM. He oked 6 yards redi mix to fill to cellar.) WOC 18 hrs(per NMOC requirement.)

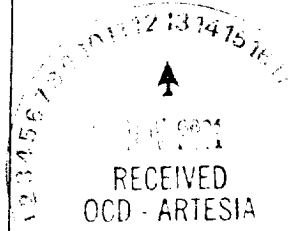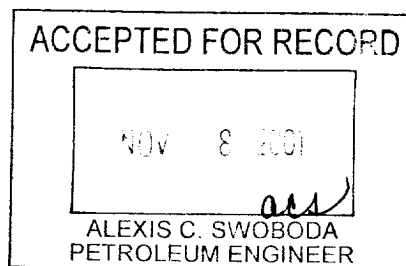

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

STERLING RANDOLPH

Title

PETROLEUM ENGINEER

Signature

Date

OCTOBER 25, 2001

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)