

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

**DISTRICT I**

P.O. Box 1980, Hobbs NM 88241-1980

**DISTRICT II**

P.O. Drawer DD, Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO. <b>30-015-02613</b>
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. <b>OG-4307</b>
7. Lease Name or Unit Agreement Name <b>Empire Abo Unit "I"</b>
8. Well No. <b>21</b>
9. Pool name or Wildcat <b>Empire Abo</b>

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator <b>ARCO Permian</b>	
3. Address of Operator <b>P.O. Box 1089 Eunice, NM 88231</b>	
4. Well Location Unit Letter <b>D</b> : <b>990</b> Feet From The <b>N</b> Line and <b>660</b> Feet From The <b>W</b> Line Section <b>6</b> Township <b>18S</b> Range <b>28E</b> NMPM <b>Eddy</b> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <b>3673' GR</b>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐


**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD: 6119' PBD: 6084' CIBP: 5845' PERFS: 5575-5710'

04/16/98: Set CIBP @ 5845'. Perf 5755-5824' w/1-11/16" strip, 1 JSPF, 12 holes. Acidize 2/1000 gals acid, using 25 ball sealers. Set CR @ 5732'. Squeeze 5755-5824' w/150 sxs Class "C" neat. Perf abo shale 5574-5710' w/select fire, 30 holes. Acidize/PPI w/3000 gals 15% acid. Frac down 3-1/2" tbg w/106000# 20/40 brady sand 1-6#.

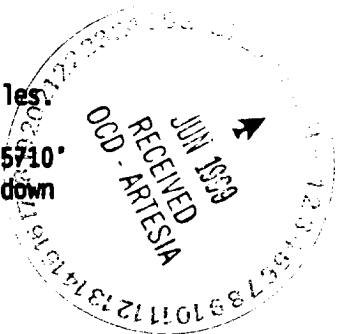

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Administrative Assistant DATE 06/29/99

TYPE OR PRINT NAME Kellie D. Murrish TELEPHONE NO. 505-394-1649

(This space for State Use)

APPROVED BY Record Only TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: