Form 3160-5 November 1983) (Formerly 9-331)

16.

UNITED STATES DEPARTMEN. OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPL' (Other instructions (Other instructiverse aide)

Form approved. Budget Bureau No. 1004-0135 Expires August 31, 1985

LEASE DESIGNATION AND BERIAL NO.

الله . د الله	COMMISSION	LC 051102-B	

SUNDRY NOTICES	AND	REPORTS OF WELLS 88210
was this form for proposals to d	rill or to	deepen or plug back to a different reservoir.

6.	if	INDIAN,	ALLOTTEE	OR	TRIBE	HAME

	Use "APPLICATION FOR PERMIT—" for s	such proposals.)	
1.	OIL GAS OTHER P&A		7. UNIT AGREEMENT NAME
2.	Yates Petroleum Corporation	RECEIVED BY	8. FARM OR LEASE NAME Ballard B
	105 South 4th St., Artesia, NM 88210	SEP 29 1986	9. WBLL NO.
4.	LOCATION OF WELL (Report location clearly and in accordance with See also space 17 below.) At surface 2310 FNL & 1650 FEL, Sec.	TISE RESE	10. FIELD AND POOL, OR WILDCAT Loco Hills-Q-G-SA 11. SHC., T., E., M., OR BLK. AND SURVEY OR ARMA Unit G, Sec. 1-18S-29E
14.	PERMIT NO. 15. ELEVATIONS (Show whet 3354 K		12. COUNTY OR PARISH 13. STATE Eddy NM

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTE	INTION TO:	SUBSEQUENT REPORT OF:		
				
TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF	REPAIRING WELL	
FRACTURE TREAT	MULTIPLE COMPLETE	FRACTUBE TREATMENT	ALTERING CASING	
SHOOT OR ACIDIZE	ABANDON*	SHOOTING OR ACIDIZING	ABANDONMENT* X	
REPAIR WELL	CHANGE PLANS	(Other)		
(Other)		(Note: Report results of multi Completion or Recompletion Re	pie completion on Well port and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS: (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) •

RUPU to P&A. Had part in $4\frac{1}{2}$ " casing 8' from surface. Ran 2-3/8" tubing open-ended to 1365', casing plugged. Moved in reverse unit. Drilled and washed to end of casing at 2705'. Drilled in open hole to 2792' with full returns to TD. Cemented open hole $w/100 \, \mathrm{sx}$ Class "C" Neat. Tag cement top at 1557'. Perforated w/4 .40" holes at 1185' (50' below salt). Squeeze perfs w/90 sx Class "C" w/2% CaCl2. Squeeze to 900#. Tag top of cement at 1023'. Perforated w/4 .40" holes at 355'. Squeeze to surface w/60 sx Class "C" Neat.

Plugging witnessed by BLM.

Set regulation abandonment marker. Well plugged and abandoned July 25, 1986.

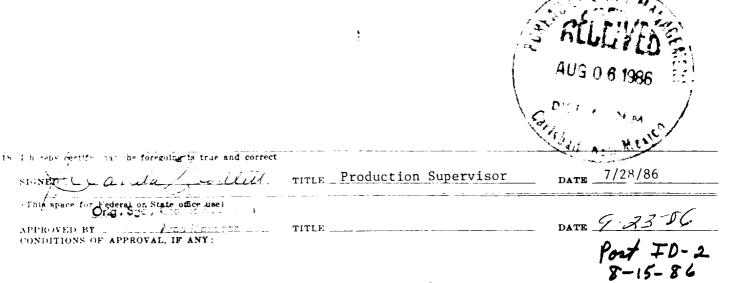

*See Instructions on Reverse Side