

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
NM OIL & GAS CONSERVATION COMMISSION
ARTESIA, NM 88210

Form approved.
Budget Bureau No. 42 R1424.
5. LEASE DESIGNATION AND SERIAL NO.
NM 025614
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> WIW - TA	RECEIVED BY SEP 29 1986 O. C. D. ARTESIA OFFICE	7. UNIT AGREEMENT NAME WEST LOCO HILLS GRB #4 SD
2. NAME OF OPERATOR NEWMONT OIL COMPANY		8. FARM OR LEASE NAME TRACT 21B
3. ADDRESS OF OPERATOR P. O. BOX 1305 ARTESIA, N.M. 88210		9. WELL NO. 5
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FNL & 1980' FWL Sec. 18-18-30		10. FIELD AND POOL, OR WILDCAT LOCO HILLS (O.G. SA)
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3516'	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 18-18-30
		12. COUNTY OR PARISH Eddy
		13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

The above well was plugged and abandoned as follows.....

1/8/83.....Spotted 25 sack plug at 2768'.


1/10/83....Tagged plug at 2427'. Perf 4 shots at 1108'. Squeezed 50 sacks @ 400 psi.

1/11/83....Tagged plug at 435'. Milled tight spot @ 80'.

1/12/83....Perf 4 shots @ 420'. Squeezed 140 sacks @ 200 psi. Circ. to surface.

1/13/83....Tagged plug at 40'. Spotted 15 sack surface plug and P&A marker

Location ready for inspection

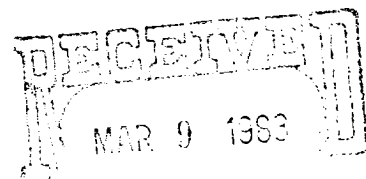

18. I hereby certify that the foregoing is true and correct.

SIGNED

[Signature]

TITLE Area Manager

DATE 3/8/83

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

9-23 FC

Post ID-2
4-1-83

PTA