Form 3160-5 (November 1983) (Formerly 9-331)

UNITEL STATES DEPARTMENT OF THE !NTERIOR BUREAU OF LAND MANAGEMENT


SUBMIT IN TRIPLICALE *
(Other Instructions on reverse side)

Budget Bureau No. 1004-0135 Expires August 31, 1985

BUREAU OF LAND MANAGEMEN!		5. LEASE DESIGNATION AND SERIAL NO.	
		NM 98121	
SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT - " for such proposals.)			6. IF INDIAN, ALLOTTEE OR TRIBE NAME
1.			7. UNIT AGREEMENT NAME
OIL WELL	GAS OTHER WIW		Skelly Unit
2. NAME OF O		2324252	8. WELL NO.
	Oil Company /	2,22,23,24,25,26,23	85
3. ADDRESS OF P.O. Box	2568 Hobbs, New Mexico 88240 (505) 392/9	97 dian.	9. API WELL NO. 30-015-05422
4. LOCATION	F WELL (Report location clearly and in accordance with any State	e requirements/ ////)	10. FIELD AND POQL, OR WILDCAT
' See also spar At surface	980' FEL	OCD RECEIVED	Grayburg Jackson 7-Rivers-QN-GB-SA
	100	OCD - ARTESIA	11. SEC., T., R., M., OR BLK. AND
660' FNL &	.980' FEL \\	5 - S/A N/	SURVEY OR AREA
Unit B	\ <u>'</u>	ેં? _{>} ્રાહ્યું	Sec. 27-T17S-R31E
14. PERMIT NO	15. ELEVATIONS (Show whether DF,	RT GRAGAGS LOS	12. COUNTY OR PARISH 13. STATE
	3824' DF		Eddy County NM
15	Check Appropriate Box to indicate Natu	re of Notice Report or Othe	
	Check Appropriate Box to indicate Nature of Notice, Report, or Other Data		
	NOTICE OF INTENTION TO:		SEQUENT REPORT OF:
TEST WATER S	TUT OFF PULL OR ALTER CASING	WATER SHUT-OFF	REPAIRING WELL
FRACTURE TR	AT MULTIPLE COMPLETE	FRACTURE TREATMENT	ALTERING CASING
SHOOT OR AC	NIZE ABANDON*	SHOOTING OR ACIDIZING	ABANDONMENT *
REPAIR WELL	CHANGE PLANS	(Other)	
	(Note: Report results of multiple completion on Well		
(Other)		Completion or Recom	pletion Report and Log form.)
17. DESCRIBE PRO	OSED OR COMPLETED OPERATIONS: (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any lively is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to his work.)		
	(continued)		
RBP to 500#.	OH & set pkr. @ 1200'. Test csg. to 500#. POH & set pkr. @ 900'. Test to 500#. POH & set pkr. @ 770'. Csg. leaking thru squeeze hole @ 802' ½ bpm @ 500#. Test backside w/pkr.		
	500#. POH w/tbg. LD pkr.		
09/04/02 RD BOP. ND	H. NU csg. collar. RUBJ Service. Pump 100 sks. Class "C" w/2% CaCl to squeeze holes @ 802' 1 bpm @ 760#. Displaced w/11 bbls. water. Hesitate 15 min. squeeze 1 bbl. @ 790#.		
	squeeze 1 bbl. @ 860#. Hesitate 30 min. squeeze ½ bbl. Squeeze @ 1600#. RD BJ. WOC.		
09/05/02 ND cementing	ilve & 5-1/2" collar. NU WH. RU BOP. RIH w/4-3/4" bit & DC's on 2-3/8" tbg. Tag cement @ 512'. Drill to 698'. Circulate hole clean.		
	98'. Drill & fell out @ 807'. Tag fill @ 2200'. Wash to RBP @ 2300'. POH w/2-3/8" DC'. LD bit. RIH w/RBP retrieving head on 2-3/8" tbg. Catch RBP @ 2300'. Unset RBP. NU		
	down overnight.		
09/07/02 POH w/2-3/8"	ng. LD RBP. RIH w/4-3/4" bit & DC's on 2-3/8" tbg. Tag fill @ 2989'. Drill out to 3317'. POH w/2-3/8" tbg. LD DC's & bit.		
09/09/02 RIH w/CIBP o	or 2-3/8" tbg. to 3300'. Set CIBP. POH. LD 2-3/8" work string & setting tool. RU Computalog WL & perforate Seven River f/2396'-98',2408'-16',21',39'-42',49',50',53',56'-59',83',87',		
& 2517'-19' v	19' v '4 SPF. RD WL. RIH w/5-1/2" AD-1 pkr. on 2-1/16" IPC tbg. to 2300'. Set pkr. Test csg. to 500# for 30 min. Circulate 70 bbls. pkr. fluid. Could not reset pkr. POH w/2-1/16" tbg. &		
safety sub.	b.		
09/10/02 RIH w/5-1/2" /	1 D-1 pkr. on 2-1/16" IPC tbg. to 2275'. Circulate 50 bbls. pkr. fluid. Set pkr. Test backside to 500#. RD BOP. NU WH. Left well injecting 100 BWPD @ 1000#. RDMO.		
18. I hereby certify th	th at the foregoing is true and correct.		
SIGNED Man	O Turner TITLE Production Tech II		DATE October 11, 2002
Mary	o Turner		
(This space for Fed	ral or State office use)		
APPROVED BY _	TITLE		DATE
	APPROVAL, IF ANY:		

*See Instruction On Reverse Side

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or represer lations as to any matter within its jurisdiction.

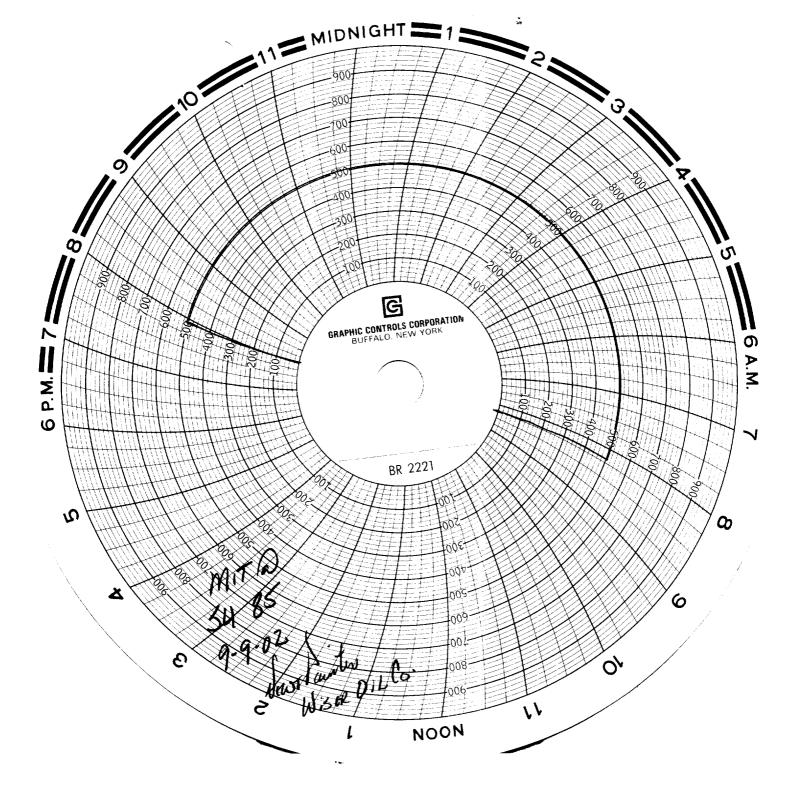



With Jimmy beenly terp