

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

95F
Op

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.
30-015-22913

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
Empire Abo Unit "J"

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐


2. Name of Operator
ARCO Permian

8. Well No.
235

3. Address of Operator
P.O. Box 1089 Eunice, NM 88231

9. Pool name or Wildcat
Empire Abo

4. Well Location
Unit Letter G : 1750 Feet From The Line and 1600 Feet From The E Line
Section 6 Township 18S Range 28E NMPM Eddy County

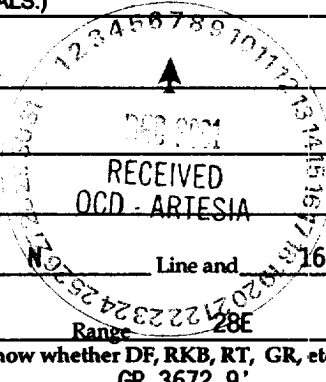

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
GR 3672.9'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Workover ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD : 6252' PBD: 6234' PERFS: 5655-6161', 6190-6207'

10/08/01: MIRUPU. Hot oil down csg w/65 bbls. POH w/rods. Hot oil down csg w/20 bbls. RD Hot Oiler. Back off rods, POH. NDHM. NUBOP. SD. POH w/rods, tbgs, & pmp.
10/10/01: RU Hot oiler. Hot oil 2-3/8" tbgs, finish POH. RIH w/bit, scraper, CO, & tbgs. SD.
10/11/01: Finished RIH. Tag @ 6217', POH. CO paraffin to 6234'. POH. SD.
10/15/01: RIH w/tbgs & BP. Set BP @ 6175'. RU wireline. Perf 5755-6161', 2 JSPF. RD.
10/16/01: RIH w/SN & OE tbgs. RU swab & tag FL @ 5950', POH. Swab dry. POH w/tbgs & SN. RIH w/pkr, SN & tbgs testing in hole. SD.
10/17/01: RU acid trucks. Spot acid @ 6125'. Set pkr @ 5708'. Acidize w/3150 gals 15% HCL NEFE.
10/18/01: RU Hot oiler. Pmp 30 bbls prod. wtr. unset pkr, POH. Well started gasing. Pmp 25 bbls prod. wtr. Finish RIH w/tbgs. Unset BP, POH. Pmp 35 bbls prod. wtr. on csg. (OVER)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Sr. Administrative Assistant DATE 12/06/01

TYPE OR PRINT NAME Kellie D. Murrish TELEPHONE NO. 505-394-1649

(This space for State Use)

APPROVED BY [Signature] TITLE Wild Dog ID DATE 12-10-01

CONDITIONS OF APPROVAL, IF ANY: