

Form 9-721
(May 1963)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPL
(Other instructions
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 067132

6. IF INDIAN, ALLOTTEE, OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Southland Royalty Company /

3. ADDRESS OF OPERATOR

1100 Wall Towers West Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

860' FSL & 2180' FEL

7. UNIT AGREEMENT NAME

ARTESIA, OHLES

8. FARM OR LEASE NAME

"21"
Empire Federal ~~1~~ Com

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Undesignated (Strawn)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 21, T-18-S, R-29-E

12. COUNTY OR PARISH 13. STATE

Eddy

NM

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3473.8' GR

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON*

SHOOTING OR ACIDIZING

ABANDONMENT*

REPAIR WELL

CHANGE PLANS


(Other) Sqz Morrow Perfs & PB to Atoka X

(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

POH w/tbg & pkr. GIH w/cmt retainer & set @ 11,225'. Stung into retainer & sqzd Morrow perfs w/100 sxs C1 "H" cmt. Pull out of retainer to 11,165' & rev out 25 sxs cmt, 10 left in csg & 65 sxs in perfs @ 11,239-11,265'. RU to perf Strawn. GIH w/tbg & pkr to 10,312'. Perf w/l JSPF from 10,420-10,422'. Swab to test Strawn perfs. Hook up to test equipment. Flwg 250 MCF/D w/small amt of oil. Acdz w/4000 gals 15% NE acid. Flwg @ 650# TP on 14/64" ck. Mk 1.63 BOPH & 550 MCF/D. SI (WOPL). SITP 2990 psi.

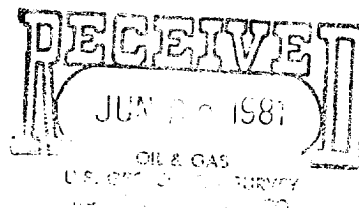

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE District Operations Engineer DATE 6/19/81

(This space for Federal or State use only)

APPROVED BY
CONDITIONS OF

ROGER A. CHAPMAN

TITLE

DATE

JUN 25 1981
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

*See Instructions on Reverse Side