

30-015-23713

7-21-81

DLL

890-2899

CD/CNL

44-2895

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-015-23713
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	LC-058127
7. Lease Name or Unit Agreement Name	Ballard Grayburg San Andres Unit
8. Well No.	26-3
9. Pool name or Wildcat	Loco Hills (Queen Grayburg San Andres)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Anadarko Petroleum Corp.
3. Address of Operator P.O. Box 2497; Midland, Texas 79702	4. Well Location Unit Letter <u>M</u> : <u>700</u> Feet From The <u>South</u> Line and <u>430</u> Feet From The <u>West</u> Line Section <u>4</u> Township <u>18-S</u> Range <u>29E</u> NMPM <u>Eddy</u> County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 6-10-99 Notified OCD. RIH w/ tbg-set CIBP, set CIBP @ 2500'. Pumped 15 sx C cmt on top of CIBP 2500 - 2273'. Load hole w/ mud. POOH w/ tbg to 1033' and pumped 25 sx C cmt @ 1033'.
6-11-99 RIH w/ tbg, tagged cmt @ 781'. Laid down tbg to 430' and pumped 30 sx C cmt 430' to surface. POOH w/ tbg, topped well off w/ cmt and RDMO.
6-14-99 Cut off wellhead and anchors. Installed dry hole marker. Covered workpit, cellar, and anchors. Left location clean and clear of trash.

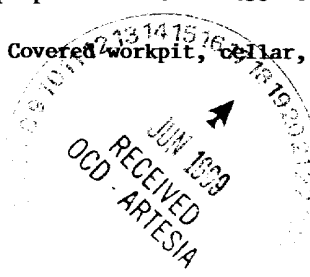

Post ID-2
7-9-99
p4H

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James F. Newman TITLE Consulting Engineer DATE 6/16/99
TYPE OR PRINT NAME James F. Newman, P.E. TELEPHONE NO. 915-687-1994

(This space for State Use)

APPROVED BY Mike S. Wellfield TITLE Field Rep. II DATE 9/10/99

CONDITIONS OF APPROVAL, IF ANY: