

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

RECEIVED

MAR - 5 1992

O. C. D.  
ARTESIA OFFICE

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well  
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Premier Production Co. ✓

3. Address and Telephone No.

P.O. Box 1246, Artesia, NM 88210

(505) 748-2093

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 22 Sw/4 NE/4

T-18S R-29E

2310 FNL & 2310 FEL

5. Lease Designation and Serial No.

NMLC055696

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Yates Premier Fed. #3

9. API Well No.

30015246800S1

10. Field and Pool, or Exploratory Area

Turkey Track, SR, Q, GB, SA

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other plug

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off


☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

We propose to plug this well in the following manner: (The 4½" casing is circulated and will be left in tact.) Rig up to pull rods & pump; go in hole w/tubing open-ended. Tag 2900'; circulate hole to balance fluid. Spot 50sax 500' class C cement; plug from 2900' to 2400'. Tag cement at 2400' & pump 500' cement plug from 2400' to 2000'. Tag plug at 2000'; pump 200' cement plug from 2000' to 1800'. Tag plug; pump 500' cement plug from 1800' to 1300'. Tag plug & pump 40sax 400' cement plug from 1300' to 900'. Tag & pump 100' plug from 400' to 300' to isolate surface casing w/top of salt. Set 50' cement plug at surface; cut off well head & install 4"x4" dry-hole marker. Back fill pits clean up location.

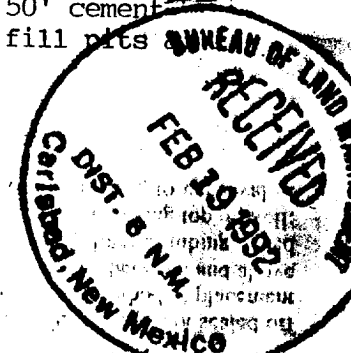

14. I hereby certify that the foregoing is true and correct

Signed

Title owner/operator

Date

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*See Instruction on Reverse Side