

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

NM OIL CONS COMMISSION
Drawer DD
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Mitchell Energy Corporation ✓

3. Address and Telephone No.

P. O. Box 4000, The Woodlands, TX 77387-4000

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1780' FSL & 800' FWL, Sec 7, T18S, R31E

5. Lease Designation and Serial No.

NM 64595

6. If Indian, Allottee or Tribe Name

N/A

7. If Unit or CA, Agreement Designation

N/A

8. Well Name and No.

PBIC Federal #1

9. API Well No.

30-015-25859

10. Field and Pool, or Exploratory Area

Shugart, N. (Bone Spring)

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☐ Subsequent Report
☒ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2/3/94 Set CIBP @ 7290'. Dump bail 25 sx cmt on top.

2/4/94 Tag plug @ 7255'. Circ hole w/mud.

2/7/94 Spot 35 sx cmt plug @ 3765'.

2/8/94 Tag plug @ 3529'. Spot additional 25 sx cmt plug @ 3529'.

2/9/94 Tag plug @ 3330'. Cut 5 1/2" csg @ 2550'. POOH LD 63 jts 5 1/2" csg. Spot 25 sx cmt plug @ 2600'.

2/10/94 Attempt to tag plug spotted @ 2600', plug was not there. Spot 30 sx cmt plug @ 2600'.

2/11/94 Tag plug @ 2455'. Spot additional 10 sx cmt plug to bring top of plug above 2450'. Spot 30 sx cmt plug + 2% CaCl₂ @ 2050'. WOC 4 hours. Attempt to tag plug, plug not there. Spot 35 sx cmt plug @ 2050'.

2/14/94 Tag plug @ 1940'. Spot 35 sx cmt plug @ 540'. Spot 25 sx cmt plug 50' to surface. Cut off wellhead. Erect P&A marker.

14. I hereby certify that the foregoing is true and correct

Signed

Joe G. Lawa

Staff Production Engineer

Title

Date

02/15/94

(This space for Federal or State office use)

Approved by

(ORIG. SGD.) JOE G. LAW


Title

PETROLEUM ENGINEER

Date

3/7/94

Conditions of approval, if any:

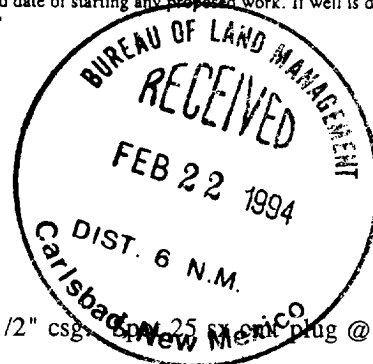

Port ID 2
4-1-94
P&A