

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
811 S. 1st Street
Artesia, NM 88210-2834

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

dlr

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT IN TRIPLICATE


1. Type of Well Oil Well Gas Well Other

2. Name of Operator
Harvey E. Yates Company

3. Address and Telephone No.
P.O. Box 1933, Roswell, NM 88202 505-623-6601

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
**Sec 5, T18S, R31E
1850' FSL & 660' FWL**

5. Lease Designation and Serial No.
NM-68040
6. If Indian, Allottee or Tribe Name
7. If Unit or CA, Agreement Designation
8. Well Name and No.
Parker Deep 5 Fed Com #1
9. API Well No.
30-015-31040
10. Field and Pool, or Exploratory Area
Shugart Morrow North
11. County or Parish, State
Eddy, NM

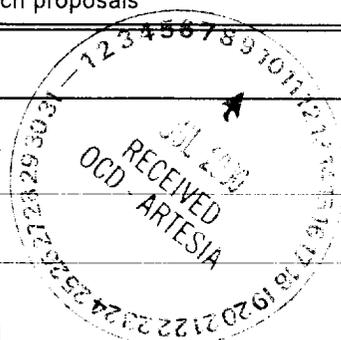

12 CHECK APPROPRIATE BOX (s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION


- Notice of Intent
- Subsequent Report
- Final Abandonment Notice

TYPE OF ACTION

- Abandonment
- Recompletion
- Plugging Back
- Casing Repair
- Altering Casing
- Other Activity on well
- Change of Plans
- New Construction
- Non-Routine Fracturing
- Water Shut-Off
- Conversion to Injection
- Dispose Water
(Note: Report results of multiple completion on Well Completion or Recompletion Report and log form)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If wells directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 6/13/00 Tagged cement @ 11,837'.
- 6/14/00 Run GR/CBL/CCL. PBTD @ 11,837, TOC @ 10,640'.
- 6/15/00 Perf 2 JSPF @ 11,726-11,728' & 11,747-11,752' (16 holes).
- 6/16/00 Pump 1000 gals 7 1/2% MSR - 100 w/additives & water, set pkr & acidize.
- 6/17/00 Swabbed down to SN - no entry.
- 6/20/00 Set CIBP @ 11,712' & dumped 10' cmt on top.
- 6/24/00 Perf 4 JSPF @ 11,574-11,586'.
- 6/27/00 Perf 4 JSPF @ 11,614-11,626'.
- 6/29/00 Run gradient & BHP test.
- 7/1/00 Ran 4 point.

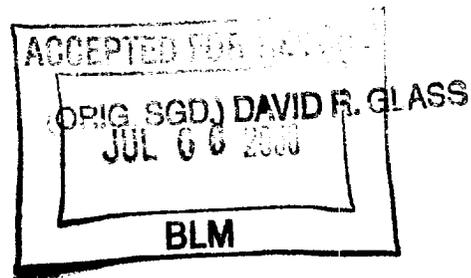

14. I hereby certify that the foregoing is true and correct

Signed Dianna Rodgers Title Production Analyst Date July 5, 2000

(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: _____