


DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. NAME OF OPERATOR
Gulf Oil Corp.
3. ADDRESS OF OPERATOR
P. O. Box 670, Hobbs, NM 88240
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface
990' FSL + 330' FWL

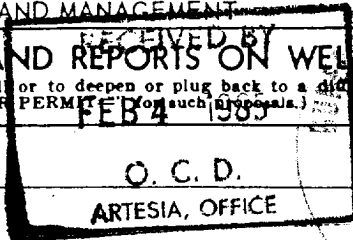

14. PERMIT NO.
15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5. LEASE DESIGNATION AND SERIAL NO.
NM 067-5
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
9. WELL NO.
114
10. FIELD AND POOL, OR WILDCAT
N. Hackberry, Water
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 24-195-30E
12. COUNTY OR PARISH
Eddy
13. STATE
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

PotH up rods, pump + load thg. Ppd 135 cu cmt @ 615'. Pump 300 cu cmt in 4 1/2" csg - no good cmt returns to surf cut 178" Jag cmt @ 126'. Dr cmt to 186'. Ppd 150 cu cmt, circ to surf. Jag cmt @ 4'. Dr to 610'. Sq dx 4 1/2" csg w/100 cu cmt. Jag cmt @ 42'. Dr to 549'. Cmt w/100 cu cmt @ 722'. Jag cmt @ 123'. Dr to 800'. Pump 100 cu cmt @ 561'. Jag cmt @ 535'. Sq hole in csg (534'-565') w/100 cu cmt. Jag cmt 57'. Dr to 562'. Set csg, pump 1.3 BPM @ 200 psi. Sq dx csg w/300 cu cmt to 550 psi. Jag cmt 180'. Jag cmt 590'. 2nd csg 200# - ok. G/H up prod eq pt. Ppg 15 BG, 271.3W, gas TSTM. Before, ppd 10 BG, 180 BW gas TSTM.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

DATE

(This space for Federal or State office use)

APPROVED BY

ACCEPTED FOR RECORD

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY

*See Instructions on Reverse Side