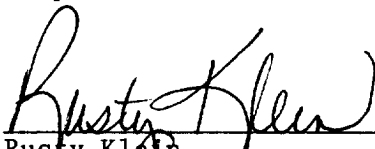


YATES PETROLEUM CORPORATION
Rudolph ATX State #1
Section 16-T19S-R31E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

5-9-2000 - Swabbed & flow tested. Shut well in.
5-10-2000 - Shut in. Rigged down pulling unit.
5-11-22-2000 - Shut in.
5-23-2000 - Moved in and rigged up pulling unit.
5-24-2000 - Bled tubing down. Pumped 25 bbls treated water. Nippled down tree. Nippled up frac valve and BOP. Released packer. Swabbed tubing and casing down to 7700'. TOOH with tubing and packer. Nippled down BOP.
5-25-2000 - Prep to frac.
5-26-2000 - Rigged up casing saver. Frac'd perforations 12335-12366' (Morrow) with 18500 gallons 40# binary, 30000# 20-40 Interprop and 10000# econoflex 20-40. Shut well in 2 hours. Opened well up and began flowing back frac.
5-27-30-2000 - Flowing back frac and flow tested.
5-31-2000 - Bled casing down. Pumped 50 bbls 7% KCL treated water. Rigged up wireline. TIH with gauge ring to 10000' - well started flowing. Bled well down. TIH to 12380' - perforations clear. TOOH. TIH with CIBP and set CIBP at 12300'. Could not get off CIBP - shear stud did not shear. Pressured up on CIBP to 1000 psi. Left well open overnight.
6-1-2000 - Bled casing down. Loaded casing with 100 bbls 7% KCL treated water. Dropped wireline cutter & cut wireline. TOOH with wireline and cutter. Rigged down wireline. TIH with short catch overshot, bumper sub and tubing. Well started flowing - pumped 15 bbls and tubing went on vacuum. TIH - well trying to flow while TIH. Pumped 10# treated brine water. Shut down due to storm.
6-2-2000 - Bled casing down. Tried to get on fish. TOOH & did not have fish. TIH with 3-1/4" box tap, bumper sub and tubing. NOTE: 5 stands off fish, pulling unit broke down. Repaired rig.
6-3-2000 - Tagged up at 12270'. Circulate sand off fish at 12286'. Tried to get on fish. TOOH - did not have fish. TIH with 3-1/4" box tap, 1 joint tubing, bumper sub and tubing.
6-4-5-2000 - Shut down over weekend.
6-6-2000 - Rigged up swivel and washed down to 12291'. Tried to get on fish with 3-1/4" box tap. Got back some sand and wire. TOOH - had a ball of wire in box tap. Showed to be on fishing neck. TIH with short catch overshot and grapple. Latched onto fish. Took 30000# over to come free. Started TOOH. Shut down due to storm.
6-7-2000 - TOOH - had fish. Rigged up wireline. TIH with junk basket and gauge ring. TOOH. TIH with CIBP and set CIBP at 12285'. TOOH and rigged down wireline. TIH with tubing. Circulate out brine water with miracle water. TOOH with tubing.
6-8-2000 - Rigged up wireline. TIH with 4" casing guns and perforated 12137-12207' w/96 .42" holes as follows: 12137-12141', 12158-12160', 12191-12193' and 12203-12207' (6 SPF - Morrow). TOOH with casing guns and rigged down wireline. TIH with RBP, packer and tubing. Straddled perforations 12191-12207' and acidized with 500 gallons 7-1/2% Morrow acid. Moved tools and straddled perforations 12137-12160' and acidized with 500 gallons 7-1/2% Morrow acid. Moved tools and straddled all perforations 12137-12207'. Swabbed. Shut well in.


Rusty Klein
Operations Technician
June 12, 2000