

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-015-23412

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
L-4673

7. Lease Name or Unit Agreement Name
State "36"

8. Well No.
1

9. Pool name or Wildcat
Undesignated Atoka

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☒ OTHER

2. Name of Operator
Mitchell Energy Corporation

3. Address of Operator
Box 4000, The Woodlands, TX 77387

4. Well Location
Unit Letter **B** : **750** Feet From The **North** Line and **2173** Feet From The **East** Line
Section **36** Township **19S** Range **21E** NMPM **Eddy** County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4245' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU PU. NU BOP. Release pkr @ 7100' and POOH w/2 3/8" tbg and pkr. RIH w/CIBP setting @ 7180'. Dump bail 35' of cement on top. RIH w/2 3/8" tbg. Load hole w/9.5 ppg mud. Spot 25 sx cement plugs 7000-6700' (Strawn), 6400-6100' (Canyon), 5880-5580' (Penn), & 4800-4500' (DV tool). POOH w/2 3/8" tbg. RIH w/csg cutter and cut 4 1/2" casing at ±4000'. POOH w/4 1/2" csg. RIH w/tbg spotting 25 sx plug 4050-3935' (csg stub), 30 sx 3520-3420' (Abo), 30 sx 2060-1960' (8 5/8" shoe, this plug must be tagged), 30 sx 1550-1460' (Glorieta), & 322'-surface. Erect P&A marker. RDMO PU. All plugs per verbal recommendation (7/22/93) of Mr. Mark Ashley, OCD, Artesia.

* Tag Stub Plug

Notify N.M.O.C.C. in sufficient time to witness

[Signature]

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *[Signature]*
TYPE OR PRINT NAME **Greg Colburn**

Staff Prod Eng

7/26/93

DATE
TELEPHONE NO. (915)682-5396

(This space for State Use)

APPROVED BY *[Signature]*
CONDITIONS OF APPROVAL, IF ANY:

TITLE *[Signature]* DATE **8/31/93**

MILLER EVERETT
CJIC 36 (4)
B, 36-19-21

7-13-43
MM

TO SURFACE

@ 272'
SXS + 9 yds. REEF-4-10
12F

need not tag if hole
stop full.

30 SXS @ 320' (13 3/8 SHOE) (TAG)

1 1/2 @ 2010'
1500 SXS

4T CASUB @ 1000'

1 PM @ 4800'
240 SXS

PERIS @ 7198-7234
7108-7112
7119-7122
7122-7144

PERIS @ 7510-7519
PERIS @ 7830, 31, 37, 38'

1 1/2 @ 8145'
460 SXS

TD 8150'

* DENOTES PRESENT

SXS = 325' CMT

GLORIETA @ 1495'

30 SXS @ 1550' (GLD)

30 SXS @ 2060' (8 3/4 SHOE) (TAG)
30 SXS @ 3520' (ABO)

ABO @ 3465'

30 SXS @ SIMB + TOC

WOLF-CAMP @ 4670'

CIAP @ 4780, 35'
~~25 SXS @ 4850'~~ (N + WC)

PENN @ 5830'

25 SXS @ 5880' (PENN)

CANYON @ 6340'

25 SXS @ 6390' (CANYON)

SIRHAN @ 6950'

25 SXS @ 7000' (SIRHAN)

NIJKA @ 7190'

CIAP @ 7180' w/35' CMT

NIJKA @ 7590'

CIAP @ 7630' w/30' CMT

CHESIER @ 7938'

MISS @ 8085'

TOC @ 4040

MILLER EVERETT
SHEC 36 (A)
B, 36-19-21

7-13-93
MM

10' SURFACE

3 7/8" @ 272'
76 SXS + 9 yds REMOVED
SURF

need not tag if hole
stop full.

30 SXS @ 320' (13 7/8" SHOE) (tag)

3 7/8" @ 2010'
1520 SXS

CHT CASE @ 1000'

IN BOX @ 4800'
290 SXS

PERIS @: 7198-7204
7108-7112
7119-7122
7172-7174

PERIS @: 7646-7649
PERIS @: 7830, 31, 32, 38'

4 1/2" @ 8145'
460 SXS

TD 8150'

* DEVIATES PRESENT

25 SXS = 325' CMT

GLORIETA @ 1495'

30 SXS @ 1550' (GLD)

30 SXS @ 2060' (8 5/8" SHOE) (tag)
30 SXS @ 3520' (ABO)

ABO @ 3465'

30 SXS @ SIMB + TOC

WOLF CAMP @ 4670'

CIAP @ 4280, 35'
~~25 SXS @ 4850'~~ (N + WC)

PENN @ 5830'

25 SXS @ 5880' (PENN)

CANYON @ 6340'

25 SXS @ 6390' (CANYON)

STRAWN @ 6950'

25 SXS @ 7000' (STRAWN)

NIJKA @ 7190'

CIAP @ 7180' w/35' CMT


NIJKA @ 7590'

CIAP @ 7630' w/30' CMT

CHICKER @ 7938'

MISS @ 8085'

TOC @ 4040

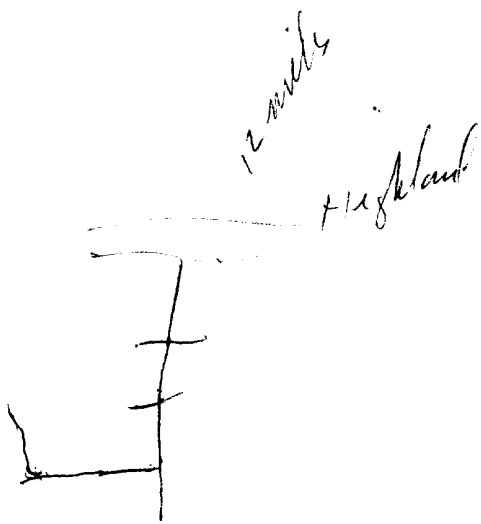

MICHELL ENERGY
 STAGE 36 (H)
 B, 76-19-21

7-13-93
 MA

10 SA SURFACE

13 3/8 @ 272'
 376 SXS + 9 yds REPAIRMENT
 SURF

30 SXS @ 320' (13 3/8 SXS) (18 yds)

8 3/8 @ 2010'
 1500 SXS

30 SXS @ 1550' (GLO)

30 SXS @ 2060' (8 3/8 SXS) (18 yds)
 30 SXS @ 3520' (18 yds)

CUT CASING @ 4000'

GLORIETA @ 1495'

30 SXS @ SURF + TOC

IN POC @ 4800'
 290 SXS

ABO @ 3465'

WOLF CAMP @ 4670'

ABO @ 4780' 35'
 25 SXS @ 4850' (IN + W.C.)

PERFS @ : 7198-7274
 7108-7112
 7119-7122
 7122-7144

PERM @ 5830'

CANON @ 6340'

STRAWN @ 6950'

ADON @ 7190'

25 SXS @ 5880' (PERM)
 25 SXS @ 6390' (CANON)
 25 SXS @ 7000' (STRAWN)
 25 SXS @ 7180' w/35' CMT

PERFS @ : 7616-7719
 PERFS @ : 7830, 31, 37, 38'

MOORE @ 7590'

CASP @ 7630' w/30' CMT

4 1/2 @ 8145'
 460 SXS

CHESTER @ 7938'

MISS @ 8085'

TO 8150'

* DENOTES PRESENT

25 SXS = 35' CMT

TOC @ 4040