

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

FORM APPROVED

Budget Bureau No. 1004-0135

Expires: March 31, 1993

5. Lease Designation and Serial No.

NM-26057

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Altwein Federal Com #1

9. API Well No.

30-015-25286

10. Field and Pool, or Exploratory Area

Undes. Morrow

11. County or Parish, State

Eddy Co., NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☒ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1-20-99 - Moved in and rigged up pulling unit.
1-21-99 - Rigged up pump truck. Pumped 50 bbls 2% KCL down tubing. Nippled down tree and nipped up BOP. Sting out of packer. TOOH with tubing and seal assembly. Did not see bombs. Shut down due to wind.
1-22-99 - TIH with mill, collars and 20 stands of tubing. Shut down due to wind.
1-23-99 - Finished TIH with shoe, extension, collars, hydraulic jars and tubing. Tagged packer at 6213'. Milled over packer. TOOH with tubing, jars, collars and shoe. Had packer, subs and pressure bombs (stuck in subs). TIH with bit, scraper and tubing. Tagged PBDT at 8300'. Pulled up to 6000'. Shut down.
1-24-99 - Swabbed. Could not swab dry. Shut well in.
1-25-99 - Flowed well down. TOOH with tubing, scraper and bit. Shut well in.
1-26-99 - Flowed well down. Rigged up wireline with lubricator and grease. TIH with logging tools and ran CR/CCL log. TOOH with logging tools. TIH with stim gun and perforated 8074-8086' w/52 .42" holes (4 SPF - Morrow). TOOH with guns. Flowed well down. TIH with 5-1/2" wireline set Uni VI packer with 1.78" blanking plug in profile nipple on bottom of packer. Set packer at 8000'. Rigged down wireline. Flowed well down. Shut well in.
1-27-99 - Bled well down. Rigged up pipe testers. TIH with on/off tool and tubing. Testing tubing to 10000 psi, tested good. Latched onto packer. Nippled down BOP and nipped up

CONTINUED ON NEXT PAGE:

14. I hereby certify that the foregoing is true and correct

Signed Rusty Kline Title Operations Technician

Date Feb. 2, 1999

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____

RECEIVED
FEB 04 30
BLM
ROSEMILL, NM


YATES PETROLEUM CORPORATION
Altwein Federal Com #1
Section 12-T19S-R23E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

tree. Set 8 points compression on packer. Swabbed well down to 6200'. Pumped 200 bbls 2% KCL down annulus. Could not load annulus. Rigged up slickline. TIH and pulled blanking plug. TOOH with blanking plug. Rigged down slickline. Swabbed. Shut well in.

1-28-99 - Rigged up treesaver. Acidized perforations 8074-8086' with 1000 gallons 7-1/2% HCL acid with 1000 scf/bbl N2. Rigged down treesaver. Flowing well back.

1-29-99 - Flow tested. Rigged up slickline. TIH with 7 day bombs and blanking plug. Set blanking plug in 1.81" profile. TOOH with slickline. Rigged down slickline. Nippled down tree. Nippled up BOP. Get off packer. TOOH with tubing. Shut down.

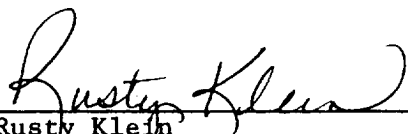

Rusty Klein
Operations Technician
February 2, 1999

RECEIVED
FEB 04 99
BLM
ROSWELL, NM