

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals


SUBMIT IN TRIPLICATE

Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

Name of Operator
ONCHO RESOURCES INC.

Address and Telephone No.
10 W. LOUISIANA STE 410; MIDLAND, TX 79701 (915) 683-7443

Location of Well (Footage, Sec., T., R., M., or Survey Description)
60' FNL & 1980' FWL, SEC. 30, 18S, 31E.

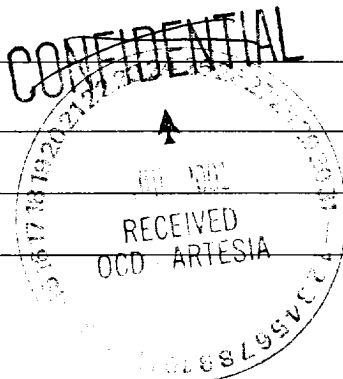

5. Lease Designation and Serial No.
LC 029387 B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
West Shugart '30' Federal #3

9. API Well No.
30015-30776


10. Field and Pool, or Exploratory Area
Shugart Bone Spring North

11. County or Parish, State
EDDY, NM

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

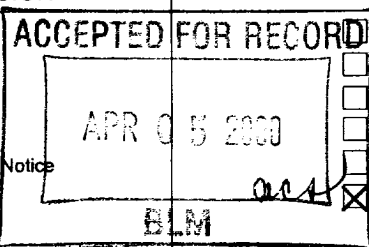

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other **COMPLETION**

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7-00 RELEASE RIG.
10-00 PERF @ 8290-8296 W/ 2 SPF.
16-00 PERF @ 8234-8250' W/ 2 SPF.
18-00 ACIDIZE PERFS @ 8234-8250' W/ 2000 GALS 15% NEFE.
19-00 PERF @ 8260-8290' W/ 2 SPF.
1-20-00 ACID PERFS @ 8234-8299 W/ 6000 GALS 15% NEFE.
1-24-00 RIH W/ 5-1/2" CIBP & SET @ 8200'; CAP W/ 35' OF CMT. RIH & PERF W/1 SPF @ 7929-7972'.
1-25-00 ACID PERFS @ 7929-7972' W/ 3800 GALS 15% NEFE.
1-26-00 SWABBING.
1-31-00 RIH W/ 5-1/2" CIBP & SET @ 7900'; CAP W/ 35' OF CMT. RIH & PERF W/ 1 SPF @ 7010-6857'. PBDT @ 7865'.
2-01-00 ACID PERFS @ 7010-6857' W/ 1800 GALS 15% NEFE.
2-05-00 ACID PERFS @ 7010-6857' W/ 8000 GALS 15% NEFE HCL & 47 TONS OF CO2.
2-06-00 FLOW BACK.
2-10-00 SHUT WEL IN @ 11:00 AM.
2-21-00 RIH W/ 5-1/2" CIBP & SET @ 6820'; CAP W/ 35' OF CMT. PERF @ 6358-6372 W/ 2 SPF. ACID W/ 1500 GALS 7.5% NEFE.
BEGIN SWABBING.
2-23-00 FRAC PERFS @ 6358-6372' W/ 28500 GALS YF 120 LG X LINK GEL; 65000# 16/30 SAND.
2-24-00 BEGIN SWABBING.
3-09-00 DRILL CMT TO 6819'. DRILL CIBP TO 6821'. CIRC CLEAN
3-10-00 RIH W/ TBG, PUMP & RODS.
3-25-00 IP @ 20 BO, 75 BW, 30 MCF.

I hereby certify that the foregoing is true and correct

Signed Title **Production Analyst** Date **03/31/00**

(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any:

