Form 3160-5 (November 1994)

.ITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

FORM APPROVED Budget Bureau No. 1004-0135 1996

 	Expires	July 31,
 	Caral N	

	•					
	NM66437					
	6. If Indian, Allottee or Tribe Nat	me				
_	7. If Unit or CA/Agreement, Nam	e and/or No.				
	8. Well Name and No.	_				
	OXY Boot Jack	1				
	Podoval					

1. Type of Well Oil Well 2. Name of Operator

OXY USA WIP Limited Partnership

P.O. Box 50250, Midland, TX 79710-0250

4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 990 FNL 1980 FEL NWNE(2) Sec 6 T19S R31E 3b. Phone No. (include area code)

915-685-5717

30-015-31925 10. Field and Pool, or Exploratory Area Hackberry Morrow, N.

NM

9. API Well No.

11. County or Parish, State Eddy

CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA 12


TYPE OF SUBMISSION	TYPE OF ACTION			
Notice of Intent	Acidize	Deepen	Production (Start/Resume)	Water Shut-Off
X Subsequent Report	Alter Casing Casing Repair	Fracture Treat New Construction	Reclamation Recomplete	Well Integrity X Other Spud,
Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarily Abandon	Set Cag & Cont
	Convert to Injection	Plug Back	Water Disposal	

Describe Proposed or Coommpleted Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has 13 determined that the final site is ready for final inspection.)

See Other Side

certify that the applicant holds legal or equitable title to those rights in the subject lease

which would entitle the applicant to conduct operations thereon.

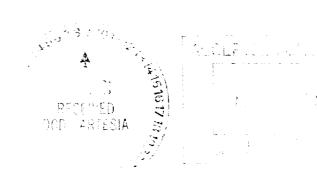

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	Title			
David Stewart	Sr. Regulatory	Sr. Regulatory Analyst		
li stet	Date volzzlo	\		
THIS SPACE	FOR FEDERAL OR STATE OFFICE USE			
Approved by	Title	Date		
Conditions of approval, if any, are attached. Approval of this notice	does not warrant or Office			

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

ATTACHMENT 3160-5 OXY USA INC. OXY BOOT JACK FEDERAL #1 SEC 6 T19S R31E EDDY COUNTY, NM

NOTIFIED BLM 8/27/01 OF SPUD. MIRU UTI #514, SPUD WELL @ 0730hrs MDT 8/27/01. DRILL 17-1/2" HOLE TO TD @ 660', 8/28/01, PUMP SWEEP, CIRC. RIH W/ 13-3/8" 48# H40 CSG, SET @ 660'. M&P 323sx 65/35 C/POZ W/ 6% BENTONITE + 2% CaCl₂ + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl₂, DISP W/ FW, BUMP PLUG, 7/6/01, CIRC 160sx CMT TO PIT, WOC-6hrs. BLM NOTIFIED AND WITNESSED. CUT OFF CASING, WELD ON STARTING HEAD, TEST TO 500#, OK. NU BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, & HYDRIL TO 1000#, OK. TOTAL WOC-18hrs, RIH & TAG, DRILL OUT & DRILL AHEAD 8/30/01.

DRILL 12-1/4" HOLE TO TD @ 3635' 9/3/01, PUMP SWEEP, CIRC. RIH W/ 9-5/8" 40/36# NCK55/K55 CSG & SET @ 3635'. M&P 1200sx 65/35 C/POZ W/ 6% BENTONITE + 1% CaCl2 + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl2, DISP W/ FW, PLUG DOWN 9/3/01, CIRC 256sx CMT TO PIT, WOC-5hrs. BLM NOTIFIED BUT DID NOT WITNESS. NU BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, CHOKE LINES, CHOKE MANIFOLD AND SAFETY VALVES TO 5000#, OK. TEST HYDRIL, MUD LINES, & CASING TO 2500#, BLM NOTIFIED OF BOP TEST, DID NOT WITNESS. TOTAL WOC-18hrs. RIH & TAG, DO CMT, DRILL AHEAD 9/5/01.

DRILL 8-3/4" HOLE TO TD @ 12340', 10/3/01, M&P SWEEP & CHC. RIH W/ OPEN HOLE LOGS, POOH. RIH W/ 5-1/2" 17# N80-P110 CSG & SET @ 12340'. M&P 1370sx 65/35/6-C/POZ/CSE W/ .7% FL-25 + .7% FL-52 + .3% CD-32 + 1% BA-61 + 8#/sx GILSONITE FOLLOWED BY 100sx CL C W/ .7% FL-25, DISP W/ KCLW, PLUG DOWN 8/25/01. CEMENT DID NOT CIRCULATE, CALC TOC-5620'. BLM NOTIFIED BUT DID NOT WITNESS. ND BOP, SET SLIPS, CUT OFF CSG, NUWH & JET CLEAN PITS, REL RIG @ 0330hrs MDT 10/6/01. SI WOCU.

