

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TR
(Other instruct.
verse side)

CATE*
on re-

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Standard Oil Company of Texas A Division of Chevron Oil Company		8. FARM OR LEASE NAME Federal 33
3. ADDRESS OF OPERATOR 3610 Avenue S, Snyder, Texas		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface Unit J; 1650 FSL & 1650 FEL of Section 33, T-21S, R-23E		10. FIELD AND POOL, OR WILDCAT Indian Basin, Upper
14. PERMIT NO.		11. FIELD AND POOL, OR WILDCAT Indian Basin, Upper
15. ELEVATIONS (Show whether DF, RT, GR, etc.) Gr. 4051'		12. FIELD AND POOL, OR WILDCAT Indian Basin, Upper
		13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Supplementary Well History

(Note: Report results of multiple completion on Wells Completion or Recompletion Report and Log form.)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Supplementary Well History

Drilled 7 7/8" hole to 6947', drilling line parted on trip. Dropped pipe on rotary table. Lost 24-65" drill collars, 1-stabilizer, 1-7 13/16" square drill collar 7 7/8" bottom hole reamer, 7 7/8" bit, fished and recovered 11-65" drill collars, unable to recover remaining collars, stabilizer, reamer and bit.

Change of Plans

1. Spot 80 sack cement and plug on top of fish at 6393'.
2. After MCC 24 hours, dress off cement plug to 6337'.
3. Set whipstock at 6337' and sidetrack junk in hole.
4. Drill 7 7/8" hole to total depth of 7900'.

RECEIVED

SEP 2 1965

G. G. C.
ARTESIA, OFFICE

RECEIVED
SEP 1 1965
U. S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

B. Davidson

TITLE

Lead Drilling Engineer

DATE

8-30-65


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

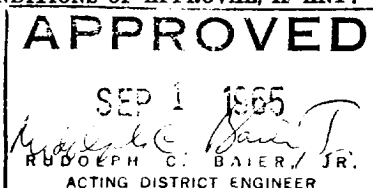

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.