

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN THE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

New Mexico 05699

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	JUL 15 1965	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR John M. Trigg	ARTESIA, OFFICE	8. FARM OR LEASE NAME Federal Acreon Mesa 8
3. ADDRESS OF OPERATOR Post Office Box 106 - Maljamar, New Mexico		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 743 Feet from North Line and 1055 Feet from West Line		10. FIELD AND POOL, OR WILDCAT Indian Basin Extension
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4230.2 gr 4246.2 kbm	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA S. 6: T22N: R24E: E26W
		12. COUNTY OR PARISH Bddy
		13. STATE N. Mex.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☒

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other) ☐

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Upon finding the Morrow Sands commercially unproductive at a total depth of 10,230', we propose the following change of plans and operations as discussed with Mr. James Knuf via telephone;

1. Condition hole and set a 50 sack inner neat cement plug from 9530 to 9670'.
2. Run 3 1/2" OD 8rd. casing to approximately 8350'.
3. Cement with 300 sacks Inner Fumix w/6% Jel & 1 lb. Floccula per sack. Followed with 300 sacks of inner neat cement with 1 lb. Floccula per sack.
4. Attempt completion.

RECEIVED
JUL 14 1965
U. S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

Kenneth E. Aston
Kenneth E. Aston

TITLE

Production Clerk

DATE

July 12, 1965


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

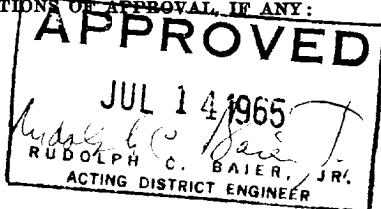

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.