

N. M. O. C. C. COPY
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN THE MANNER
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER 2. NAME OF OPERATOR Gulf Oil Corporation 3. ADDRESS OF OPERATOR P.O. Box 670, Hobbs, New Mexico 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1650' FW & EL, Section 22, 22-S, 23-E 14. PERMIT NO.	5. LEASE DESIGNATION AND SERIAL NO. NM-068032 6. IF INDIAN, ALLOTTEE OR TRIBE NAME 7. UNIT AGREEMENT NAME 8. FARM OR LEASE NAME Halbing - Federal 9. WELL NO. 2 10. FIELD AND POOL, OR WILDCAT Indian Basin - Penn 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 22, 22-S, 23-E 12. COUNTY OR PARISH Eddy 13. STATE New Mexico
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 1650' OL	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☒	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7823' TD, 7794' FB.
Ran Baker Model D packer and set at 7510'. Ran 2-3/8" tubing. Circulated hole with 250 barrels of water. Set tubing in packer at 7510' with 12,000# compression. Swabbed water from tubing to approximately 5500'. Perforated 5-1/2" casing with 1, 9/16" seallog gun with 2 shots at 7573', 7605', 7621', 7637', 7665' and 7684'. Swabbed to seating nipple. No show of oil or gas. Treated with 1000 gallons of break down acid. Flushed with water. Maximum treating pressure 2970#, broke to 1000#. A I R 2.8 bpm. ISIP 500#, after 1 minute on vac. Swabbed. No show of oil or gas. Will submit notice of intention to plug and abandon.

RECEIVED

FEB 24 1966

O. C. C.
ARTESIA, OFFICE

RECEIVED

FEB 23 1966

U. S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED _____

TITLE **Area Production Manager**

DATE **February 18, 1966**


(This space for Federal or State office use)

APPROVED _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

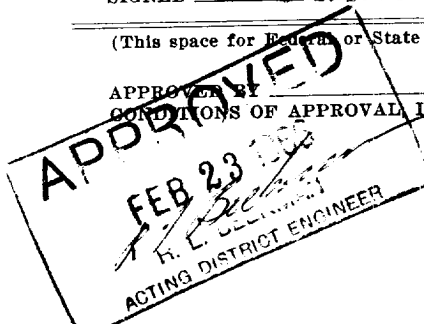

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.