

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
88210


Budget Bureau No. 1004-0135
Expires August 31, 1985

45P

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	5. LEASE DESIGNATION AND SERIAL NO. NM-0554235
2. NAME OF OPERATOR Pennzoil Company ✓	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Drawer 1828, Midland, Texas 79702	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980 FNL & FWL of Sec. 31, T-20-S, R-30-E	8. FARM OR LEASE NAME Penn-Federal
14. PERMIT NO.	9. WELL NO. 1
15. ELEVATIONS (Show whether DP, RT, or other) 3307.6 GL	10. FIELD AND POOL, OR WILDCAT Golden Lane (Morrow) Und. Morrow
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 31, T-20-S, R-30-E
	12. COUNTY OR PARISH Eddy
	13. STATE New Mexico

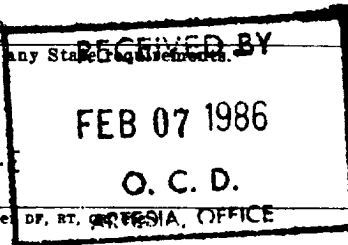

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

It is proposed to permanently abandon the subject well by spotting cement plugs as follows:

Surf-50'	20 sx Class H
200-500'	110 sx Class H - covers top of salt and 13-3/8" shoe
1530-1650'	40 sx Class H - covers bottom of salt section and D.V. tool
4016-4116'	40 sx Class H - covers 8-5/8" shoe - will tag
4350-4500'	50 sx Class H - Delaware
6400-6550'	50 sx Class H - Bone Springs top
7350-7500'	50 sx Class H - Bone Springs
7850-8000'	50 sx Class H - stub plug - will tag
8200-11745'	100 sx Class H

Tops

Top Salt	±200'
Bottom Salt	±1600'
Bone Springs	6436'
Wolfcamp	9846'
Strawn	11067'
Atoka	11211'
Morrow	11995'

18. I hereby certify that the foregoing is true and correct

SIGNED Randy Hodgins
Randy Hodgins

TITLE Petroleum Engineer

DATE 1/31/86

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE 2/6/86

*See Instructions on Reverse Side