


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

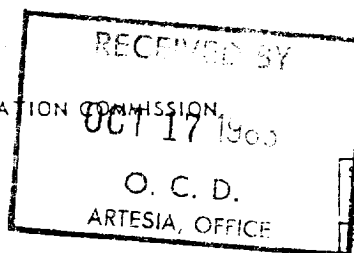

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

9. Indicate Type of Lease
State ☐ Per ☐
10. State Oil & Gas Lease No.
NM-18293

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - 1" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Cities Service Oil & Gas Corporation	8. Name of Lease Name Government AA Com
3. Address of Operator P.O. Box 1919, Midland, Texas 79702	9. Well No. 1
4. Location of well UNIT LETTER C 660 FEET FROM THE north LINE AND 1980 FEET FROM THE west LINE, SECTION 23 TOWNSHIP 20S RANGE 28E NMPM.	10. Field and Pool, or interest Burton Flat-Wolfcamp
11. Elevation (Show whether DF, RT, GR, etc.) 3227' GR	12. County Eddy

13. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER Failure of filing packer leakage test ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

PBTD 11,487'. 5-1/2" csg @ 11,533'. Morrow perfs 11,222-229' (TA), Wolfcamp perfs 9205-63'. Job to repair communication.

MIRU PU. ND tree. NU BOP. Rel Baker Model R-1 dual pkr and POOH w/tbg and pkr. RIH w/bit and scraper. Tag Model DB pkr w/plug in place at 11,090'. POOH w/bit, scraper and tbg. RIH w/5-1/2" Baker lok-set pkr on 2-7/8" tbg. Set pkr @ 9512'. Test csg and Model DB pkr to 1000 psi - held OK. Rel pkr & POOH w/403' 2-7/8" tbg. Set pkr @ 9109'. ND BOP & NU tree. Swab well in. Recomplete well as a single Wolfcamp producer.

9-16-83- Jim Gilleam
said he would check
this out. He did
not approve
of the work


18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Startz TITLE Region Operations Manager DATE October 14, 1983

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

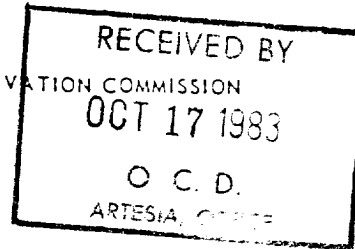

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☐
5. State Oil & Gas Lease No.
NM-18293

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Cities Service Oil & Gas Corporation	8. Name of Lease Name Government AA Com
3. Address of Operator P.O. Box 1919, Midland, Texas 79702	9. Well No. 1
4. Location of well UNIT LETTER C 660 FEET FROM THE north LINE AND 1980 FEET FROM THE west LINE, SECTION 23 TOWNSHIP 20S RANGE 28E N.M.P.M.	10. Field and Pool, or Wildcat Burton Flat-Wolfcamp
15. Elevation (Show whether DF, RT, GR, etc.) 3227' GR	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER Failure of filling packer leakage test ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

PBTD 11,487'. 5-1/2" csg @ 11,533'. Morrow perfs 11,222-229' (TA), Wolfcamp perfs 9205-63'. Job to repair communication.

MIRU PU. ND tree. NU BOP. Rel Baker Model R-1 dual pkr and POOH w/tbg and pkr. RIH w/bit and scraper. Tag Model DB pkr w/plug in place at 11,090'. POOH w/bit, scraper and tbg. RIH w/5-1/2" Baker lok-set pkr on 2-7/8" tbg. Set pkr @ 9512'. Test csg and Model DB pkr to 1000 psi - held OK. Rel pkr & POOH w/403' 2-7/8" tbg. Set pkr @ 9109'. ND BOP & NU tree. Swab well in. Recomplete well as a single Wolfcamp producer.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Startz

TITLE Region Operations Manager

DATE October 14, 1983

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: