


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

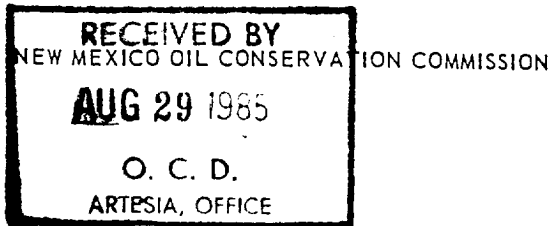

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. NM 40625/ NM 84B
7. Unit Agreement Name
8. Farm or Lease Name Catclaw Draw St. Com.
9. Well No. 2
10. Field and Pool, or Wildcat Catclaw Draw (Morrow)
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <input type="checkbox"/>
2. Name of Operator TXO Production Corp. ✓
3. Address of Operator 900 Wilco Bldg. Midland, TX 79701
4. Location of Well UNIT LETTER <u>H</u> , <u>2000</u> FEET FROM THE <u>North</u> LINE AND <u>890</u> FEET FROM THE <u>East</u> LINE, SECTION <u>18</u> TOWNSHIP <u>21-S</u> RANGE <u>26-E</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 3272.8 GR

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-20-85 Rlsd pkr. TOO H w/2 3/8" tbq. TIH w/CIBP @10,415. 35' cmt on top. Set 25sx "H" plug @9373. Set 25sx "H" plug @8121.
8-21-85 Cut 4 1/2" csg @7570.
8-22-85 Spt 35sx "C" plug @7606. Tagged plug @7520. Set 35sx "C" plug @5816. Set 35sx "C" plug @2304.
8-23-85 Tagged cmt @2240. Set 25sx "C" plug @556. Set 10sx "C" plug @surface & installed dry hole mkr. Well P & A'd.

Post FD-2
9-13-85
R & A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Celicia Henderson TITLE Engr. Asst. DATE 8-28-85

APPROVED BY Danell Moore TITLE Geologist DATE 3/11/86

CONDITIONS OF APPROVAL, IF ANY: