

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYDrawer DD
Alorsia, NM 88210

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
2. NAME OF OPERATOR
PERRY R. BASS
3. ADDRESS OF OPERATOR
P.O. Box 2760, MIDLAND, TX. 79702
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FNL & 1980' FILL UNIT LOTTER
AT TOP PROD. INTERVAL: F
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF
- ☐
-
- FRACTURE TREAT
- ☐
-
- SHOOT OR ACIDIZE
- ☐
-
- REPAIR WELL
- ☐
-
- PULL OR ALTER CASING
- ☐
-
- MULTIPLE COMPLETE
- ☐
-
- CHANGE ZONES
- ☐
-
- ABANDON*
- ☐

SUBSEQUENT REPORT OF:

(other) SPUD DATE & SURFACE CSG & 8 7/8" CSG.

5. LEASE

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

9. WELL NO.

10. FIELD OR WILDCAT NAME


11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

12. COUNTY OR PARISH

13. STATE

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

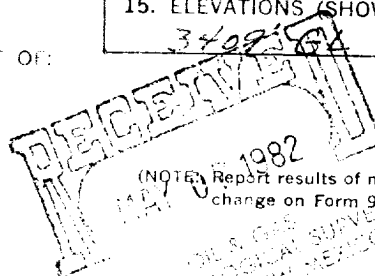

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

SPUD 6:45 PM MDT 4-27-82

DRLG. 15" HOLE TO 515', RAN 12 JTS. 11 3/4" 42# H-40 STC

CSG. SET AT 515', CEMENTED W/400 SX CLASS "C" W/ADDITIVES

PLUG DOWN @ 5:00 P.M. MDT 4-28-82 BURIED PLUG TO 800 PSI.

HELD OK. CIRCULATE 200 SX. WOC 18 3/4 HRS. DRLG. FLOAT COLLAR

& SHOE. NOTE: ARLAND CORE W/USGS WITNESS. DRLG. 11" HOLE.

4-29-82. TEST BOP, CSG. CK. UNIFIED TO 1,000# HELD. D.K.

DRLG. 11" HOLE TO 3288' - 5-4-82.

RAN 75 JTS. 8 5/8" 28# 5-80, STC CSG. CSG. RUN W/DIFFERENTIAL FILL
FLOAT COLLAR & GUIDE SHOE & 5 CENT. CEMENTED W/1100 SX POZMIX 65-25 LITE

Subsurface Safety Valve: Manu. and Type

Set @

Ft.

OVER

18. I hereby certify that the foregoing is true and correct

SIGNED

R.C. Hutchins

TITLE

Production Clerk

DATE

May 4, 1982

(This space for Federal or State office use)

APPROVED BY

GS

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between, and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

W/ADDITIVES, TAILED IN W/200 SX CLASS "C" W/ADDITIVES. DUMP PLUG TO -
1500 PSI @ 4:45 PM MDT 5-4-82 FLOAT HELD CIRC. 370 SX TO SURFACE
HAMS - USGS PETE HEINZ WITNESS JOB. WLOC 28 3/4 HAS. TEST BLIND RAMS TO
1100 PSI OK. TAGGED CEMENT @ 3194', TEST CCG, & PIPE RAMS TO 2000 PSI OK
DELG. FLOAT COLLAR & GUIDE SHOE PRESSURED CCG. SEAT TO 600 PSI OK
COMMENCED DRUG 7 7/8" HOLE 5-5-82.