

BUREAU OF LAND MANAGEMENT

NM-57602

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

| | | | |
|---|--|--|--|
| 1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> | | 6. IF INDIAN, ALLOTTEE OR TRIBE NAME | |
| 2. NAME OF OPERATOR INDREX, Inc. | | 7. UNIT AGREEMENT NAME | |
| 3. ADDRESS OF OPERATOR 7633 E. 63rd Place, Suite 500, Tulsa, Oklahoma 74133 | | 8. FARM OR LEASE NAME Federal 15 | |
| 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 2080' from North line and 1980' From East Line | | 9. WELL NO. 1 | |
| 14. PERMIT NO. 30-CIS-25741 NM-57602 | | 10. FIELD AND POOL OR WILDCAT Revelation-Bone Spring | |
| 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3502 GL | | 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 15, T-22-S, R-25-E | |
| | | 12. COUNTY OR PARISH Eddy | |
| | | 13. STATE NM | |

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


| NOTICE OF INTENTION TO: | | SUBSEQUENT REPORT OF: | |
|--|---|--|--|
| TEST WATER SHUT-OFF <input type="checkbox"/> | PULL OR ALTER CASING <input type="checkbox"/> | WATER SHUT-OFF <input type="checkbox"/> | REPAIRING WELL <input type="checkbox"/> |
| FRACTURE TREAT <input type="checkbox"/> | MULTIPLE COMPLETION <input type="checkbox"/> | FRACTURE TREATMENT <input type="checkbox"/> | ALTERING CASING <input type="checkbox"/> |
| SHOOT OR ACIDIZE <input type="checkbox"/> | ABANDON* <input type="checkbox"/> | SHOOTING OR ACIDIZING <input type="checkbox"/> | ABANDONMENT* <input checked="" type="checkbox"/> |
| REPAIR WELL <input type="checkbox"/> | CHANGE PLANS <input type="checkbox"/> | (Other) <input type="checkbox"/> | |

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

On 5-3-89 notified BLM & got verbal approval to plug & abandon well as follows:

1. Pulled rods and found 2-3/8" tbg stuck @ tbg anchor @ 4305'.
2. Cut tbg @ 4290' & pulled.
3. Set 5-1/2" CIBP on WL @ 4288'.
4. Displace hole w/100 bbl 10.0 ppg mud.
5. Spot 5 sx Cl H cmt plug 4288'-4246'.
6. Cut 5-1/2" csg @ 2086' then pull & LD 48 jts csg.
7. RIH w/2-3/8" tbg & spot 30 sx Cl H cmt plug 2136'-2016'.
8. WOC 12 hrs & tag cmt plug @ 1950'.
9. Spot 30 sx Cl H cmt plug 600'-500'.
10. Spot 15 sx Cl H cmt plug 60' to surf
11. Cut off wellheads 3' BGL & install dry hole marker 5-8-89.

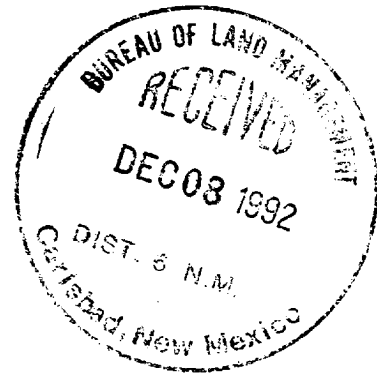

Approved as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

18. I hereby certify that the foregoing is true and correct

SIGNED Mickey Dolan TITLE Agent for INDREX, Inc. DATE 9-23-91

(This space for Federal or State office use)

APPROVED BY David R. Mas TITLE Supervisor DATE 12/30/92

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side