

DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

(Other Instructions on Reverse Side)

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Fortson Oil Company

3. ADDRESS OF OPERATOR

301 Commerce Street, Suite 3301 Fort Worth, TX 76102

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface

1980' FNL & 467' FWL, SW/4 NW/4, Unit E

14. PERMIT NO.

15. ELEVATIONS (Show whether DT, RT, GR, etc.)

3263' GR

5. LEASE DESIGNATION AND SERIAL

NM-84721

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Sylvite Federal

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Und. Parkway-Delaware

11. SEC., T., R., M., OR BLE. AND SURVEY OR AREA

Sec. 6, T-20-S, R-30-E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANT

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other) Daily Drilg. Rpt. & 4 1/2" Casing Rpt. XXX

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. Fully state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

3/26/91: Total depth 4001'. Present operation: Logging. Formation sand and dolomite. Circulated samples at 3718' and 3746'. Deviation survey at 3757' 1/2°, at 4001' 3/4°.

3/27/91: Total depth 4001'. Present operation: Circulating, preparing to cement second stage of cement. (See reverse side for complete casing and cementing report.)

3/28/91: Total depth 4001'. Present operation: Waiting on completion.

RECEIVED
APR 9 9 50 AM '91
CARLSBAD AREA OFFICE
1300 E. 11TH ST.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Agent

DATE

4/1/91


(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

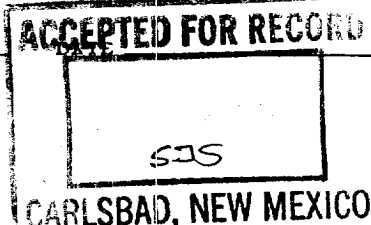

<u>ITEM (BOTTOM TO TOP)</u>	<u>LENGTH</u>	<u>TOP of SECTION -K.B.</u>
1 - Weatherford Float Shoe	0.74'	4,001.91' K.B.
1 - Joint 4-1/2" 8rd 10.5#/ft., J-55 ST&C	42.01'	3,959.90' K.B.
1 - Weatherford Float Collar	0.86'	3,959.04' K.B.
26 - Joints 4 1/2" 8rd 10.5#/ft., J-55 ST&C	1078.27'	2,880.77' K.B.
1 - Weatherford D.V. Tool	2.20'	2,878.57' K.B.
69 - Joints 4 1/2" 8rd 10.5#/ft., J-55 ST&C	2873.57'	5.00' K.B.
Total Joints	3997.65'	
K.B. to G.L.	5.00'	
Casing set at	4002.65' K.B.	

NOTE: Ran Fifteen centralizers (1) 5' above float shoe, (1) 5' above float collar, and (1) each on collars #4, #6, #8, #9, #10, #11, #12, #13, #14, #16, #18, #20, and #28 (collar above D.V. at 2878').
 Ran 1 cement basket on collar #26 (collar below D.V. tool at 2878').

Circulated hole for 90 minutes with rig pump and cemented as follows:

Pumped 10 barrels fresh water.

First Stage:

Pumped 200 sacks 50/50 poz (Base C) cement with 2% gel, 0.4% CF-2, 0.25#/sack cello seal (1.26 cu.ft./sk., yield, 14.2#/gallon).

Displaced with 53.18 barrels fresh water.

Did not bump plug (wash up line to pits leaking).

Opened D.V. tool and pumped through tool.

Circulated 66 sacks cement to pit.

Wait on cement 6 hours.

Pumped 10 barrels fresh water.

Second Stage:

Pumped 115 sacks Pacesetter Lite cement with 6% gel (1.98 cu.ft./sk. yield, 12.4#/gallon).

Tailed in with 100 sacks Class "C" with 2% CACL2 (1.32 cu.ft./sk., yield, 14.8#/gallon).

Displaced with 45.36 barrels fresh water.

Plug down at 9:20 AM on March 27, 1991.

Close D.V. tool, circulate 28 sacks cement to pit.

Mr. Duncan Whitlock with the BLM witnessed the cementing operations.