

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires July 31, 1999

C/SF

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator OXY USA INC. 16696

3a. Address P.O. BOX 50250
MIDLAND, TX 79710-0250

3b. Phone No. (include area code) 915-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1980 FWL 660 FWL SWNW (E) Sec 4 T20S R27E

5. Lease Serial No.
NM92756

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
OXY Figs Newton Federal #1

9. API Well No.
30-015-31098


10. Field and Pool, or Exploratory Area
WC Morrow

11. County or Parish, State
EDDY NM


12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other <u>Spud, Set</u>
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	<u>CSS & Cmt</u>
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

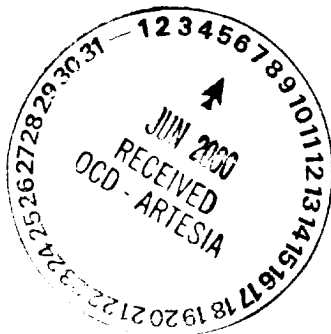

See other side

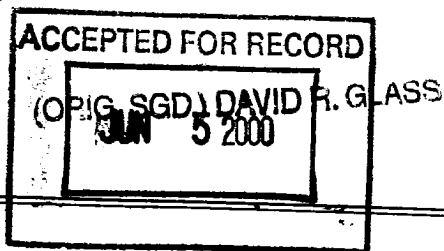

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

DAVID STEWART

Title

REGULATORY ANALYST

Signature

Date

6/2/00

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by _____ Title _____ Date _____

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office _____

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)

ATTACHMENT 3160-5
OXY USA INC.
OXY FIG NEWTON FEDERAL #1
SEC 4 T20S R27E
EDDY COUNTY, NM

NOTIFIED BLM 5/20/00 OF SPUD. MIRU UTI #207, SPUD WELL @ 2330hrs MDT 5/20/00. DRILL 17-1/2" TO TD @ 404', 5/21/00, PUMP SWEEP. RIH W/ 13-3/8" 48# H40 CSG & SET @ 404'. M&P 160sx 65:35 C/POZ W/ 6% BENTONITE + 2% CaCl₂ + .25#/sx CELLOFLAKE FOLLOWED BY 200sx CL C W/ 2% CaCl₂, DISP W/ FW, PLUG DOWN 0145hrs MDT 5/22/00, CIRC 44sx CMT TO PIT, WOC-4hrs. BLM NOTIFIED & CATHY WITNESSED CMT JOB. CUT OFF CASING, WELD ON STARTING HEAD, TEST TO 500#, OK. NU BOP & CHOKE MANIFOLD, TIH W/ BIT & BHA, TEST CASING & HYDRIL TO 500#, OK. TOTAL WOC-18hrs. RIH & TAG, DRILL OUT & DRILL AHEAD 5/22/00.

DRILL 12-1/4" HOLE TO TD @ 3018' 5/27/00. RIH W/ 9-5/8" 36# K55 CSG & SET @ 3018'. M&P 950sx 65:35 C/POZ W/ 6% BENTONITE + 1% CaCl₂ + .25#/sx CELLOFLAKE + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl₂ DISP /FW, PLUG DOWN 5/27/00, CIRC 450sx CMT TO PIT, WOC-6hrs. BLM NOTIFIED & DON EARLY WITNESSED CMT JOB. CUT OFF CSG & INSTALL B SEC, TEST TO 2000#, OK. NU BOP, TEST TO 5000#, OK. TEST CSG, MUD LINE & ANNULAR TO 2500#, OK. NU ROTATING HEAD, RIH & DO CMT & SHOE, DRILL NEW FORMATION, TEST CSG, OK. DRILL AHEAD 5/29/00.

RECEIVED
2000 JUN -5 A 10:46
OXY USA INC.