

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. DIV-Dist. 2
1301 W. and Avenue
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Pogo Producing Company

3. Address and Telephone No.

P. O. Box 10340, Midland, TX 79702-7340 (915)685-8100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FSL & 660' FWL, Section 12, T22S, R22E

5. Lease Designation and Serial No.
NM-92739

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Dalton 12 Federal #1

9. API Well No.

30-015-31938

10. Field and Pool, or Exploratory Area

Rocky Arroyo Wolfcamp (Gas)

11. County or Parish, State

Eddy County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Perf Morrow & Strawn

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

10/19/01 Perf Morrow 9392'-9410' & 9366'-80' w/ 2 spf. Swab.


10/20/01 Set CIBP @ 9344'.

10/21/01 Perf Morrow 9298'-9306' w/ 4 spf. Acldz w/ 19 bbls acid + 74 bbls CO2. Swab.

10/25/01 RIH w/ CIBP & set @ 9248'. Perf Strawn 8596'-8603', 8612'-35' & 8660'-68' w/ 2 spf. Dump 50' cmt on CIBP.

10/26/01 Acldz Strawn w/ 2000 gals 15% NEFE acid.

10/30/01 RIH w/ CIBP & set @ 8546'. Dump 50' cmt on CIBP.

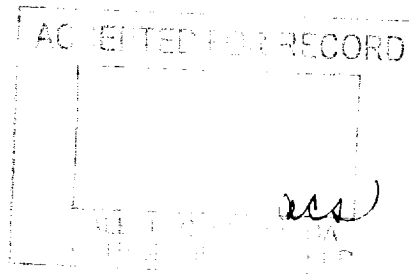

14. I hereby certify that the foregoing is true and correct

Signed Cathy Lambert Title Sr. Operations Tech Date 11/15/01
(This space for Federal or State office use)

Approved by
Conditions of approval, if any:

Title

Date