


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

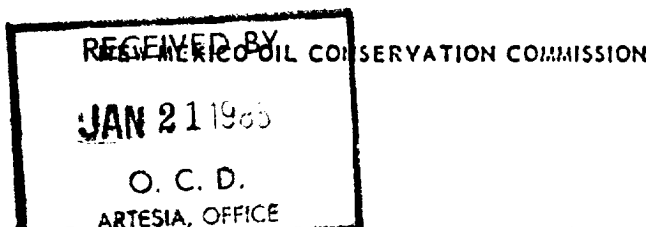

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL ON THE OIL FIELD OR PUMP BACK TO A DIFFERENT RESERVOIR.  
USE APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER: <u>Temporarily Abandoned</u> <u>F&amp;A</u>	7. Unit Agreement Name
2. Name of Operator <u>Mobil Producing TX. &amp; N.M. Inc.</u>	8. Farm or Lease Name <u>Maude Rickman Com.</u>
3. Address of Operator <u>Nine Greenway Plaza, Suite 2700, Houston, Texas 77046</u>	9. Well No. <u>1</u>
4. Location of Well UNIT LETTER <u>L</u> <u>2203.7</u> FEET FROM THE <u>South</u> LINE AND <u>839.7</u> FEET FROM THE <u>West</u> LINE, SECTION <u>3</u> TOWNSHIP <u>23S</u> RANGE <u>27E</u> NMPM.	10. Field and Pool, or Wildcat <u>Undesig. (Wolfcamp)</u>
11. Elevation (Show whether DF, RT, GR, etc.) <u>3113 GR</u>	12. County <u>Eddy</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12,300 TD, 10,345 PBD, Wolfcamp Perfs 10,172-10,196.

12-5-84

MIRU Marrs Csg Pullers, Bled well down, killed well w/45 bbls 10# Br Wtr down tbq, ND well head, NU BOP, Attempted to Rel Baker loc set pkr @ 10,100' for 2 hrs, no success.

12-6-84

Worked tbq 6 hrs attempting to rel 7" LOC set pkr @ 10,100, no success, Rel from EL recept. @ 10,096, POH w/224 jts 2-3/8" tbq, Les Clement w/NMOCC gave permission to have pkr in hole & set CIBP.

12/7-9/84

Fin POH w/2-3/8" tbq & EL rec. Marrs set 7" Pengo CIBP @ 10,098', RIH w/2-3/8 tbq OE to 10,060', notified Les Clement w/NMOCC.

12-10-84

Marrs spot 15/x C1s C from CIBP @ 10,098 to 10,000', spot 25 sx C1s C 8940 to 8840, spot 25sx C1s C 7550 to 7450', spot 55 sx C1s C 5750 to 5470, pulled tbq to 3600'.

12-11-84

15 hr SI/s1 bubbling, Marrs spot 33 sx C1s C from 3600' to 3500', spot 33 sx C1s C from 2200 to 2100, spot 33 sx C1s C cmt from 400 to 300, POH w/tbg, pressure plugs to 500#, job witnessed by Larry Brooks w/NMOCC.

12-12-84

Marrs spot 15sx C1s C from 50' to surf, cut off well head weld on plate & install P&A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief. marker, RD & Rel Marrs @ 11:30AM

SIGNED W.B. [Signature] TITLE Authorized Agent DATE 1-14-85

APPROVED BY [Signature] TITLE Geologist DATE 4-15-85

CONDITIONS OF APPROVAL, IF ANY: