

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N. M. Oil Corp. Division
811 S. 1st St.
ARTESIA, NM 88210-2834

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Pogo Producing Company

3. Address and Telephone No.

P. O. Box 10340, Midland, TX 79702-7340 (915)685-8100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

330' FNL & 1650' FWL, Section 33, T23S, R31E

5. Lease Designation and Serial No.

NM-96234 45236

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Sterling Silver 33 Federal #5

9. API Well No.

30-015-27424

10. Field and Pool, or Exploratory Area

Sand Dunes Delaware West

11. County or Parish, State

Eddy County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Add Additional Pay
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

06/29/00 Set CIBP @ 7825'. Perf Delaware 7746'-60' w/ 2 spf. Test CIBP to 3200# ok. Went on vac after acid spot. RIH & set RBP @ 7640'. Perf Delaware 7586'-7602' w/ 2 spf.


06/30/00 Acdz 7586'-7602' w/ 1000 gals 7-1/2% HCL. Swab.

07/01/00 Release RBP @ 7640'. Pull RBP to 7500'. Test to 3000# ok. Perf Delaware 7326'-36' & 7414'-20' w/ 2 spf.

07/02/00 Acdz 7326'-36' & 7414'-20' w/ 1000 gals 7-1/2% HCL. Swab.

07/04/00 Release RBP @ 7500' & POOH. Knock out CIBP @ 7825'.

07/05/00 Run production equipment & return well to production.

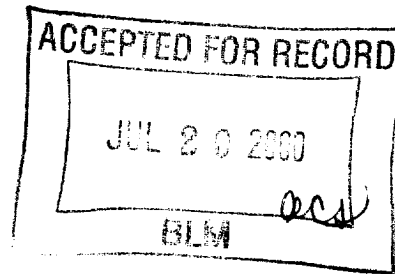

14. I hereby certify that the foregoing is true and correct

Signed Cathy Imbed

Title Operation Tech

Date 07/18/00


(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date

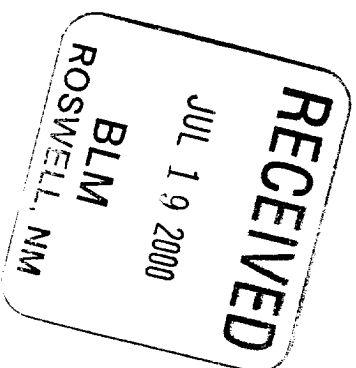

RECEIVED

JUL 19 2000

BLM
ROSWELL, NM