

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Oil Cons.
N.M. Div. 1st. 2
1301 W. Grand Avenue
Artesia, NM 88210

FORM APPROVED
Bureau No. 1004-0135
Expires: March 31, 1993

C19F

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No.

P. O. Box 1030
Roswell, New Mexico 88202-1030

505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1460' FSL & 1585' FWL
Section 12-23S-29E

5. Lease Designation and Serial No.

NM-0554221

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. Unit Agreement Name

Nash Unit

8. Well Name and No.

Nash Unit #36

9. API Well No.

30-015-30176

10. Field and Pool, or Exploratory Area

Nash Draw Brushy Canyon

11. County or Parish, State

Eddy County, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☒ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

04/23/02: RU. TOH w/production string. PU and GIH w/RBP. Set RBP at 6454'. Circ hole w/2% KCL. Spot 1-1/2 BBLS acid at 6360'. TOH w/tbg. SISD.

04/24/02: RU. TIH w/tools. Log 6420' to 5500'. CBL. TOH w/tools. PU and GIH w/4" csg guns. Perf 14 (.42) holes as follows: 6333'-6349'. TOH w/guns. PU & GIH w/pkr. Set pkr at 6252'. Break down and acidize w/1500 gal 7-1/2% NeFe. RU and swab well down. SISD.

04/27/02: RU Dowell. Frac via 2-7/8" tbg w/12,800# 16/30 resin coated sand. SI and prep to flow back.

04/28/02: RU. Flow well down. RU swab.

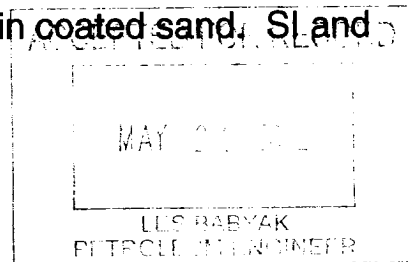

14. I hereby certify that the foregoing is true and correct

Signed Kelly M. Britt

Title Production Records

Date 05/20/2002

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

Accepted for record
NMOCU

RECEIVED
2002 MAY 21 AM 9:24
FEDERAL BUREAU OF INVESTIGATION
U.S. DEPARTMENT OF JUSTICE