

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells


1. Type of Well GAS 2. Name of Operator BURLINGTON RESOURCES OIL & GAS COMPANY 3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700 4. Location of Well, Footage, Sec., T, R, M 1110' FSL, 1390' FEL, Sec. 36, T-30-N, R-6-W, NMPM, Rio Arriba	API # (assigned by OCD) 30-039-27284 5. Lease Number 6. State Oil&Gas Lease # E-347-49-NM 7. Lease Name/Unit Name San Juan 30-6 Unit 8. Well No. 443S 9. Pool Name or Wildcat Basin Fruitland Coal 10. Elevation:
--	---

Type of Submission	Type of Action
☐ Notice of Intent	☐ Abandonment
☒ Subsequent Report	☐ Recompletion
☐ Final Abandonment	☐ Plugging Back
	☐ Casing Repair
	☐ Altering Casing
	☒ Other -
	☐ Change of Plans
	☐ New Construction
	☐ Non-Routine Fracturing
	☐ Water Shut off
	☐ Conversion to Injection

13. **Describe Proposed or Completed Operations**

Burlington Resources completed workover operations as per attached daily summary.

SIGNATURE Frances Bend Regulatory Specialist April 12, 2004

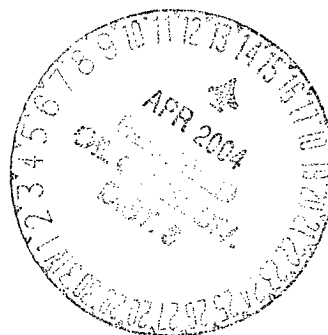

(This space for State Use)

Approved by Chas. R. [Signature] Title _____ Date APR 14 2004

DEPUTY OIL & GAS INSPECTOR, DIST. #2 APR 14 2004



San Juan Division - Intranet Well Information System (DIMS)

Friday, April 2, 20

--Logon--	--By Date--	--By Well--	--By AFE--	--By Rig--
--Printouts--	--Production Notes--	--Accountability--	--Safety--	
	--Other--	API Units		

Export to Excel

Operations Detail Report for: SAN JUAN 30-6 UNIT #443S LOE WORK

Entire Well / All Events

Time Breakdown Summary

DAY	FROM	TO	HRS	DEPTH (ft)	PHASE	CODES	OPERATION
1 (LWK)	02/11/2004 06:00	07:00	1.00		OBJECT	SAFE a	N 2/11/2004 TRAVEL TO LOCATION HELD SAFETY MEETING TOPIC HARD HATS BR SUPERVISOR TJR CREW
1 (LWK)	02/11/2004 07:00	07:30	0.50		OBJECT	SRIG a	N SERVICE RIG GREASE
1 (LWK)	02/11/2004 07:30	08:30	1.00		OBJECT	MIMO a	N WARM UP RIG & EQUIP. LOAD OUT EQUIP PREP TO MOVE
1 (LWK)	02/11/2004 08:30	09:30	1.00		OBJECT	MIMO a	N MOVE RIG & EQUIP. TO SJ 30-6 #443S
1 (LWK)	02/11/2004 09:30	10:00	0.50		OBJECT	RURD a	N SPOT RIG & EQUIP. ON LOCATION
1 (LWK)	02/11/2004 10:00	11:00	1.00		OBJECT	RURD a	N RU SPOT PUMP RIG UP PUMP TO TBG TEST TO #1200
1 (LWK)	02/11/2004 11:00	11:30	0.50		OBJECT	RURD a	N HANG OFF RODS RU ROD EQUIP. UNSEAT PUMP PREP. TO TOOH
1 (LWK)	02/11/2004 11:30	12:00	0.50		OBJECT	SHDN a	N EAT LUNCH
1 (LWK)	02/11/2004 12:00	13:00	1.00		OBJECT	TRIP a	N TOOH W/ 2"X11/4"X14' RAHC-Z W/4-11/4" K-BARS 141-3/4" RODS 6'-4'-3/4" PONIES 11/4"X22' PR W/LINER LD PUMP
1 (LWK)	02/11/2004 13:00	14:00	1.00		OBJECT	NUND a	N ND WELL HEAD NU & TEST BOP RU TBG EQUIP.
1 (LWK)	02/11/2004 14:00	15:30	1.50		OBJECT	TRIP a	N UNSEAT TBG HANGER TI & TAG BTM @ 3685' TOOH W/ 23/8 PROD. TBG TALLY ALL CLEAN OUT BHA HAD COAL FINES
1 (LWK)	02/11/2004 15:30	17:00	1.50		OBJECT	TRIP a	N PU & INSTALL BHA TIH W/23/8 PROD. TBG 116-JTS TOTAL PREP. TO INSTALL SURFACE PUP JTS SHUT TBG IN

1 (LWK)	02/11/2004 17:00	18:00	1.00		OBJECT	RURD a	N	DRAIN UP PUMP & LINES TURN CSG TO 'SALES' SDFN TRAVEL TO TJR YARD
2 (LWK)	02/12/2004 06:00	07:00	1.00		OBJECT	SAFE a	N	2/12/2004 TRAVEL TO LOCATION HELD SAFETY MEETING TOPIC HOUSE KEEPING BR SUPERVISOR TJR CREW TJR TOOL PUSHER
2 (LWK)	02/12/2004 07:00	07:30	0.50		OBJECT	SRIG a	N	SERVICE RIG GREASE WARM UP RIG HYDRO SYSTEM
2 (LWK)	02/12/2004 07:30	08:30	1.00		OBJECT	TRIP a	N	CSG PSI 20# TBG 0# ADD TBG SUBS INSTALL & SEAT TBG HANGER TBG 1-6'-23/8 TBG SUB W/PLUG 1-COLLAR SIZE GAS SEP. 1-12'-23/8 SUB 1-3'-23/8 SUB 1-23/8 SEAT NIPPLE 115-JTS 23/8 TBG 1-10'-23/8 SUB 1-6'-23/8 SUB 1-JT 23/8 TBG BTM OF TBG @ 3679' SEAT NIPPLE @ 3653'
2 (LWK)	02/12/2004 08:30	09:30	1.00		OBJECT	NUND a	N	ND BOP NU WELL HEAD RU ROD EQUIP.
2 (LWK)	02/12/2004 09:30	10:00	0.50		OBJECT	PULD a	N	PU NEW PUMP W/ 4-11/4" K-BARS CREW WARM UP
2 (LWK)	02/12/2004 10:00	11:00	1.00		OBJECT	TRIP a	N	TIH W/2"X11/4"X14' RHAC-Z PUMP W/4-11/4" K- BARS 141-3/4" RODS 1-6'-3/4" PONY 1-11/4"X22' PR W/10'LINER
2 (LWK)	02/12/2004 11:00	11:30	0.50		OBJECT	PRES a	N	RU PUMP TO TBG LOAD & TEST TBG TO 1200# HELD
2 (LWK)	02/12/2004 11:30	12:00	0.50		OBJECT	RURD a	N	SET BTM TAG ON RODS HANG OFF RODS ON BEAM STROKE TO 500# GOOD PUMP ACTION
2 (LWK)	02/12/2004 12:00	12:30	0.50		OBJECT	SHDN a	N	EAT LUNCH
2 (LWK)	02/12/2004 12:30	13:30	1.00		OBJECT	RURD a	N	CLEAN UP LOCATION RIG DOWN RTP PREP TO MOVE TO 30-6 #439
2 (LWK)	02/12/2004 13:30	14:30	1.00		OBJECT	RURD a	N	RD PUMP DRAIN UP PUMP & LINES TRAVEL TO TJR YARD