
Form 3160-5 UNITED STATES (August 1999) DEPARTMENT OF THE AND MANAGEMENT				FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000 5. Lease Serial No.	
SUNDRY NOTICE	L AND REPORTS	MENTE VEI	√LU	1	
Do not use this foliation abandoned well. Use Fo	r proposals to drill or	r tố Te-enter an	PM 1: 15	6. If Indian, A	1 Allottee or Tribe Name
SUBMIT IN TRIPLICATE, Other instructions on reverse side ington, NM				7. If Unit or	CA/Agreement, Name and/or No
1. Type of Well Oil Well X Gas Well Other				8. Well Name	e and No.
2. Name of Operator ConocoPhillips Company				SJ 31-6 U	
		3b. Phone No. (include area code)		9. API Well No. 30-039-27467	
5525 Highway 64, NBU 3004, Farming		505-599-3454			Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Unit D (NWNW), 855' FNL & 1010' FWI Section 1, T30N, R6W	· ·		e a c z e e su		itland Coal r Parish, State a, NM
12. CHECK APPROPRIATE	E BOX(ES) TO INC	DICATE NATURE OF	NOTICE, REP	ORT, OR OT	HER DATA
TYPE OF SUBMISSION TYPE OF ACTION					
X Notice of Intent Subsequent Report	Acidize Alter Casing Casing Repair	Deepen Fracture Treat New Construction	Production Reclamatio		Water Shut-Off Well Integrity X Other
Final Abandonment Notice	Change Plans Convert to Injection	Plug and Abandon	·	ly Abandon	BOP Configuration Change
13. Describe Proposed or Completed Operation (clear If the proposal is to deepen directionally or recom Attach the Bond under which the work will be perfollowing completion of the involved operations. testing has been completed. Final Abandonment determined that the final site is ready for final insponse but to problems with the planned configuration initially submitted. 1. Change in BOP to a double rail 2. To request an exception to 01 - Allow us to test our BOP are requirements - Allow us to test our BOP and Onshore Order #2 requirements See attached BOP Schematics - one casing and the other for the caving the state of the caving and the other for the caving and the c	mplete horizontally, give significant or provide the infinite provide the provide shall be filled on ection.) BOP Key Energy and to the following instead of an anishsore order #2 and 9-5/8" surface and 9-5/8" surface and 7" casing (for int.	ubsurface locations and mea Bond No. on file with BLM n a multiple completion or n ily after all requirements, in was using, ConocoP ng: annular and single to e casing to 1000 p r the cavitation p	asured and true ver d/BIA. Required so recompletion in a n acluding reclamation Phillips need ram osi in lieu o program) to 1	tical depths of a ubsequent report new interval, a F nn, have been co is to chang of Onshore	order #2 lieu of
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	Patsy Clugston	Title SHEAR	Administrati	ive Assista	nt
talser Clugitim		Date 8/18.	/03		
ТН	S SPACE FOR FED	ERAL OR STATE OF	FICE USE		
Approved by /s/ Jim Lovato		Title		Da	ate AUG 2 0 2003
Conditions of approval, if any, are attached. Approval certify that the applicant holds legal or equitable title to which would entitle the applicant to conduct operations to	o those rights in the subj	arrant or Office			1.00 2 0 2000
Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section States any false, fictitious or fraudulent statements or rep	ion 1212, makes it a crime		and willfully to mal	ke to any depart	ment or agency of the United

BLOWOUT PREVENTER ARRANGEMENT & PROGRAM

For Drilling to Intermediate Casing Point & Setting 7" Intermediate Casing

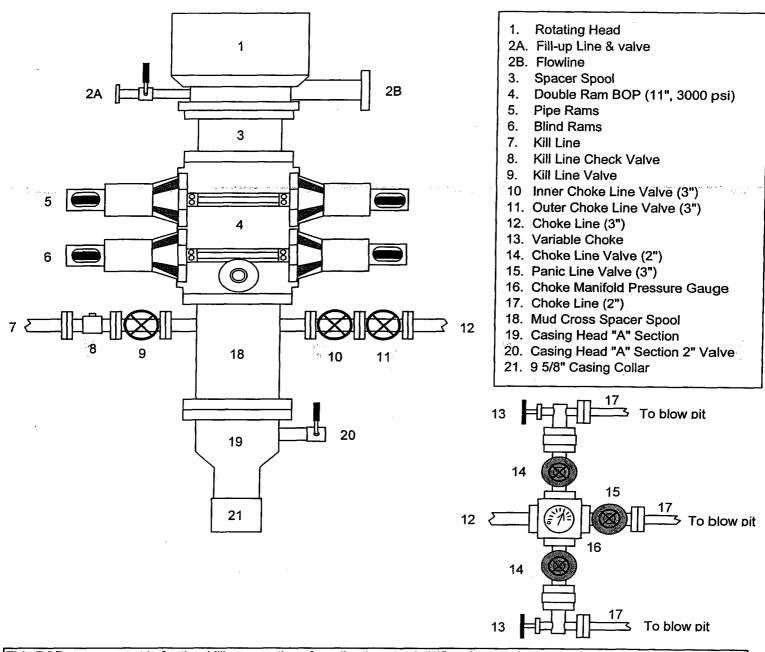


This BOP arrangement is for the drilling operations from the time the 9-5/8" surface casing is set through the setting of the 7" intermediate casing. The Casing Head "A" Section will be screwed onto the 9-5/8" surface casing stub. The BOP will be installed on the Casing Head "A" Section. The Pipe Rams, Blind Rams, Choke Manifold, and 9-5/8" surface casing will be tested to a low pressure test of 200 psi to 300 psi and to a high pressure test of 1000 psi (this value is 44% of the minimum internal yield pressure of the 9-5/8" casing). We will drill the 8-3/4" hole to intermediate casing point and run and cement the 7" intermediate casing. Then we will nipple down the BOP, install a trash cap, & move out the drilling rig. We will install the casing spool on the 7" stub after the drilling rig is moved off location. At a later date we will move in the cavitation rig for the cavitation program.

In addition to the equipment in the above diagram the following equipment will comprise the BOP system:

- 1. Upper Kelly cock Valve with handle
- 2. Stab-in TIW valve for all drillstrings in use

BLOWOUT PREVENTER ARRANGEMENT & PROGRAM

For Cavitation Program

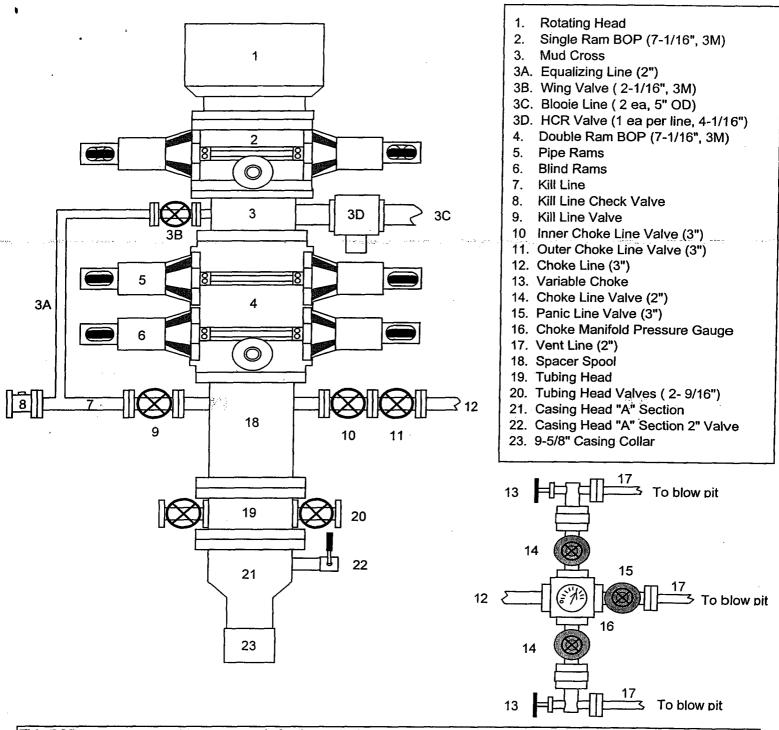

This BOP arrangement and test program is for the cavitation program. The BOP will be installed on the tubing head. The 7" casing will be pressure tested against closed blind rams to 200 psi to 300 psi for 2-3 minutes and to 1800 psi for 30 minutes - this test pressure is 48% of the minimum internal yield strength of 3740 psi for the 7", 20#, J-55, STC casing. The pipe rams and choke manifold will be tested to 200 psi to 300 psi (low pressure test) for 2-3 minutes and to 1800 psi (high pressure test) for 10 minutes - This test will be done with a test plug or possibly without a test plug (ie against casing). If we conduct this test without a test plug we will ensure that we have sufficient drillstring weight in the hole to exceed the upward force generated by the test.

We use a power swivel and air/mist to drill the 6-1/4" hole in our cavitation program. We do not use a kelly. In addition to the equipment in the above diagram the following equipment will comprise the BOP system:

- 1. String floats will be used inside the drillpipe
- 2. Stab-in TIW valve for all drillstrings in use
- 3. Each blooie line is equipped with a hydraulically controlled valve (HCR valve).