

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an  
Abandoned well. Use Form 3160-3 (APD) for such proposals.*

FORM APPROVED  
OMB No 1004-0135  
Expires July 31, 2010

5 Lease Serial No.

**NM - 04208**

6 If Indian, Allottee or tribe Name

**RCVD OCT 30 '07**

7 If Unit or CA/Agreement, Name and/or No.

**OIL CONS. DIV.**

**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well



Oil Well



Gas Well



Other

**OCT 26 2007**

2. Name of Operator

**BP AMERICA PRODUCTION COMPANY**

**Bureau of Land Management  
Farmington Field Office**

8. Well Name and No

**Warren Com 2M**

**DIST. 3**

9. API Well No.

**30-045-25567**

3a. Address

**PO BOX 3092 HOUSTON, TX 77253**

3b. Phone No. (include area code)

**281-366-4081**

10. Field and Pool, or Exploratory Area

**Blanco Mesaverde**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

**985' FSL & 1400' FEL; SEC 14 T28N R09W SWSE**

11. County or Parish, State

**SAN JUAN, NM**

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OR NOTICE, REPORT, OR OTHER DATA**

**TYPE OF SUBMISSION**



Notice of Intent



Subsequent Report



Final Abandonment Notice

**TYPE OF ACTION**



Acidize



Deepen



Production (Start/Resume)



Water shut-Off



Alter Casing



Fracture Treat



Reclamation



Well Integrity



Casing Repair



New Construction



Recomplete



Other Well Cleanout & Csg  
Integrity Test



Change Plans



Plug and Abandon



Water Disposal



Convert to Injection



Plug Back

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.

On 7/27/07 BP America requested permission to locate and repair casing leak. Approval was granted 7/30/07.

No Casing Leak was found but did find scale bridge at the top of the MV perforations. Please see the following subsequent report.

9/26/07 Pres test BOP 250 low & 1500 high; held OK.

9/28/07 Scale on Tbg. that was POH. 10/2/07 Mill out Scale 4120' - 4178' w/air & mist.

10/1/07 Acidized with 12 bbls 15% HCl.

10/3/07 TIH set RBP @4070'. Load hole & circ out gas - Press test to 750 psi - Held OK (see chart attached). Release & TOH w/ RBP.

10/4/07 - 10/9/07 C/O to 4934'.

10/10/07 TIH land 2 3/8", 4.7#, J-55 Tbg @4821'.

14. I hereby certify that the foregoing is true and correct  
Name (Printed/typed)

**Cherry Hlava**

Title **Regulatory Analyst**

Signature *Cherry Hlava*

Date **10/23/2007**

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Title

Date

**ACCEPTED FOR RECORD**

**OCT 29 2007**

Conditions of approval, if any, are attached. Approval of this notice does not warrant or Certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon


Office

**FARMINGTON FIELD OFFICE**  
BY *[Signature]*

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*(chart p. 2)*

**NMOCD**

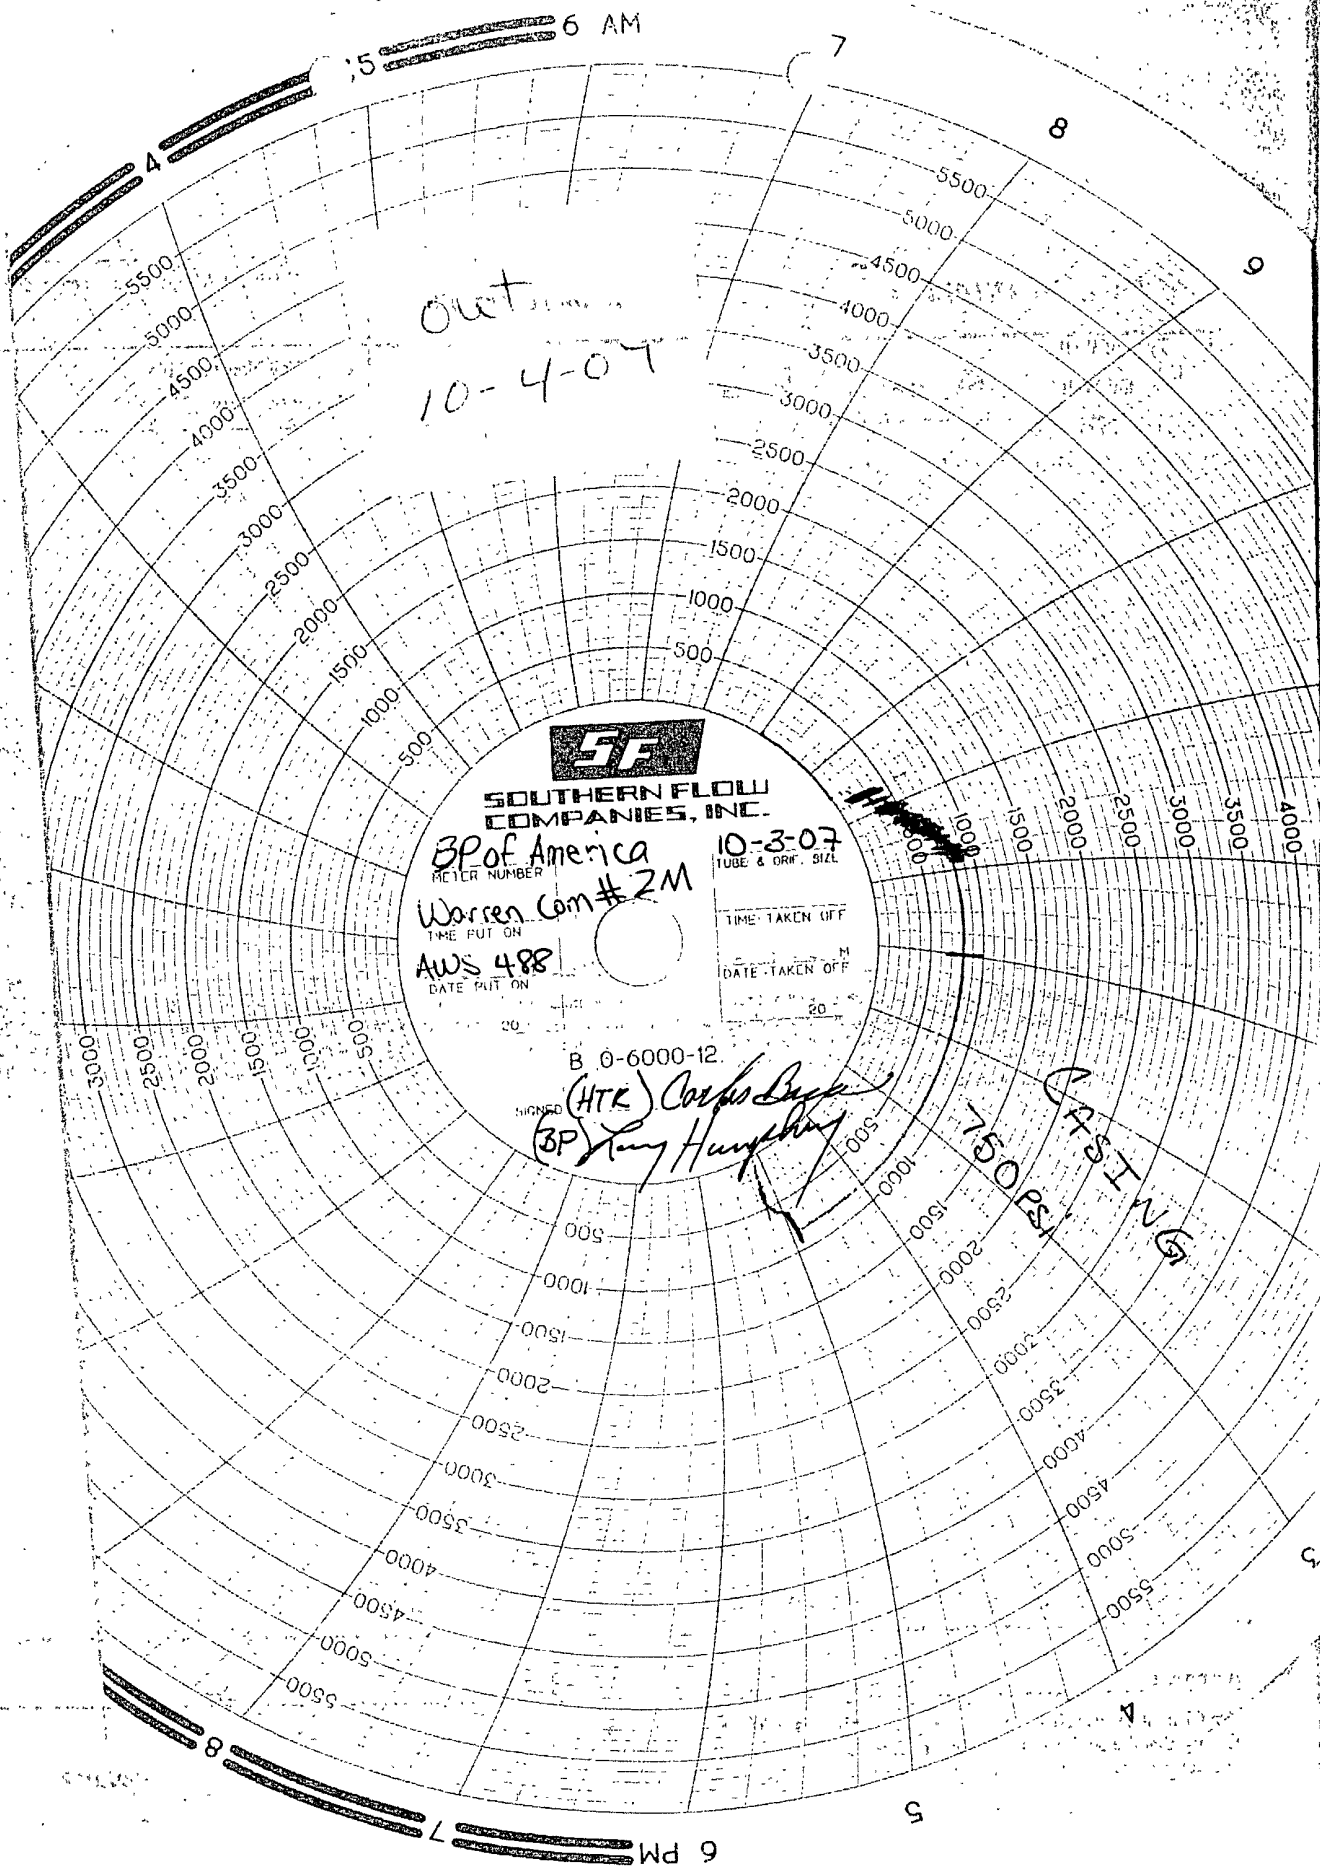

out  
10-4-07

BP of America  
METER NUMBER  
Warren Com # 2M  
TIME PUT ON  
AWS 488  
DATE PUT ON

10-3-07  
TUBE & ORIF. SIZE

TIME TAKEN OFF

DATE TAKEN OFF

B 9-6000-12

SIGNED (HTK) *Corpus Decker*  
(BP) *Long Humphrey*

*10-3-07*  
*10-4-07*  
*10-5-07*  
*10-6-07*  
*10-7-07*  
*10-8-07*  
*10-9-07*  
*10-10-07*  
*10-11-07*  
*10-12-07*

10-4-07