

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.



SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. SE-077111	
2. NAME OF OPERATOR Beta Development Co.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR 234 Petr. Club Plaza, Farmington, N. M.		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 840/5 1230/4		8. FARM OR LEASE NAME Blanco Wash Federal	
14. PERMIT NO.		9. WELL NO. 3	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6215 GR		10. FIELD AND POOL, OR WILDCAT Benin Dakota	
16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data		11. SEC. T. R. M., OR BLK. AND SURVEY OR AREA 27-28N-9W 14E	
17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true-vertical depths for all markers and zones pertinent to this work.)*		12. COUNTY OR PARISH San Juan	
		13. STATE N.M.	

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☒	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☒	ABANDONMENT ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)			

6-26-65 Rigged up, picked up 2" tbg. CO to 6905'.
6-27-65 Drilled IV tools @ 2451 & 4776'. Tested esp. to 4000', held OK. Spotted 500 gals 7-1/2% HCA acid. Ran Gamma Ray & correlation log. Perf: 6856-60, 6876-82 & 6890-98' w/4 JPF. FBD 2200#. SNF w/10,000# 40-60 ad & 20,000# 20-40 ad, 33,040 gals treatment wtr., 39,690 gals tot. wtr. TP 3000-3200#, ATP 3100# @ 37 BPM. SI 1800#, 5 MSI 1600#. Set cast iron BP @ 6840'. Perf: 6720-24' w/4 JPF. FBD 2000#. Perf: 6757-74' w/2 JPF. SNF w/40,000# 20-40 ad., 41,000 gals treatment wtr, 46,410 gals tot. wtr. TP 3100-2400#, ATP 2775# @ 39.9 BPM. SI 1200#, 5 MSI 1000#, SI 3 hrs.
6-28-65 W/H w/tbg. drilled BP @ 6840'. Ran 220 jts. 6881.56! 2-3/8" EUB 4.7# J-35 T&C tbg w/pin collar & 1' nipple set @ 6894'. Pumped out plug, blowing well to clean up. Rig released midnight 6-28-65.

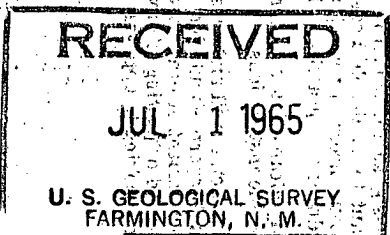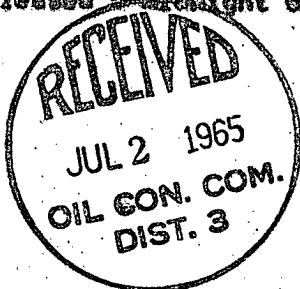

18. I hereby certify that the foregoing is true and correct
Original signed by:
SIGNED JOHN T. HAMPTON TITLE Manager DATE 6-30-65
(This space for Federal or State office use)
APPROVED BY _____ TITLE _____
CONDITIONS OF APPROVAL, IF ANY: