

District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-039-23192
5. Indicate Type of Lease STATE ☐ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Gavilan
8. Well Number 3
9. OGRID Number
10. Pool name or Wildcat Blanco Mesa Verde
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 7307' GR

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☐ Gas Well ☒ Other	
2. Name of Operator NM&O Operating Company	
3. Address of Operator 15 E. Fifth, Ste. 3000, Tulsa, OK 74103	
4. Well Location Unit Letter <u>L</u> : <u>1850</u> feet from the <u>North</u> line and <u>990</u> feet from the <u>West</u> line Section <u>26</u> Township <u>25N</u> Range <u>2W</u> NMPM County <u>Rio Arriba</u>	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ TEMPORARILY ABANDON ☐ CHANGE PLANS ☒ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ DOWNHOLE COMMINGLE ☐ OTHER: ☐		SUBSEQUENT REPORT OF: REMEDIAL WORK ☒ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ P AND A ☐ CASING/CEMENT JOB ☐ OTHER: ☐	
--	--	--	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8/18/2008 thru 9/25/08. MIRU Well Service Unit Release tbg. anchor and pull and lay down 1 jt 2 3/4" tbg. NUBOP. POOH w/235 jts 2 3/4" tbg, SN and mud anchor. RIH w/tbg open ended and land at 7400'. MI Superior Well Services ("Superior"). Load hole then mix and pump cmt. plug #1 being 13 sx (15.4 cu. ft.) of type 5 neat cmt. from 7400' to 7228'. Displace w/28 bbls wtr. Check plug balance—good. Pull up hole 10 stands, then clear tbg. w/26 bbls wtr. POOH w/ tbg Pick-up cmt. retainer & RIH on 108 stands tbg. and set @ 6756'. String out, then flow back into retainer. Prepare to pump cement plug #2. Load backside then hook up to tbg. Pressure up to 1500 psig - no injection rate established but slight bleed off Call Mr. Kelly Roberts w/NMOCD to get approval to spot 100' cmt plug on top of retainer. Verbal approval granted. String out of retainer then mix and pump 13'sx (15.4 cu. ft.) of type 5 neat cmt. and displace w/25 bbls wtr. Check plug balance—good Pull 8 jts tbg. then reverse w/1 bbl wtr. Release Superior. POOH w/tbg laying down. NDBOP MI Select Oil Tools ("Select"). NDWH. RIH W/4 1/2" spear & pull to 75k. Release slips, stack out 4 1/2" and release spear. Rig-up wireline. Spear csg. and run free point 4 1/2" csg 100% free @ 4100' Tag cmt. plug 2 in 4 1/2" csg. @ 6590'. RD wireline Spear csg and set slips w/40k. Release Select, NUWH. Rig down and release well service unit. Note: Will temporarily abandoned operations to complete Mesa Verde interval pending further evaluation.

4/23/09: MI Blue Jet. Run Cement Bond Log from 6510' to 4000'. Release Blue Jet.


Spud Date:

Rig Release Date:

RCVD OCT 13 '09
OIL CONS. DIV.
DIST. 3

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE President DATE 10/8/09
Type or print name Larry D. Smith E-mail address: Larry.Smith@state.nm.gov PHONE: (915) 584-3800
For State Use Only
APPROVED BY: [Signature] TITLE Deputy Oil & Gas Inspector, District #3 DATE OCT 20 2009
Conditions of Approval (if any): FILE IN A TIMELY MANNER - SEE NMOCA RULE 19.15.7.14

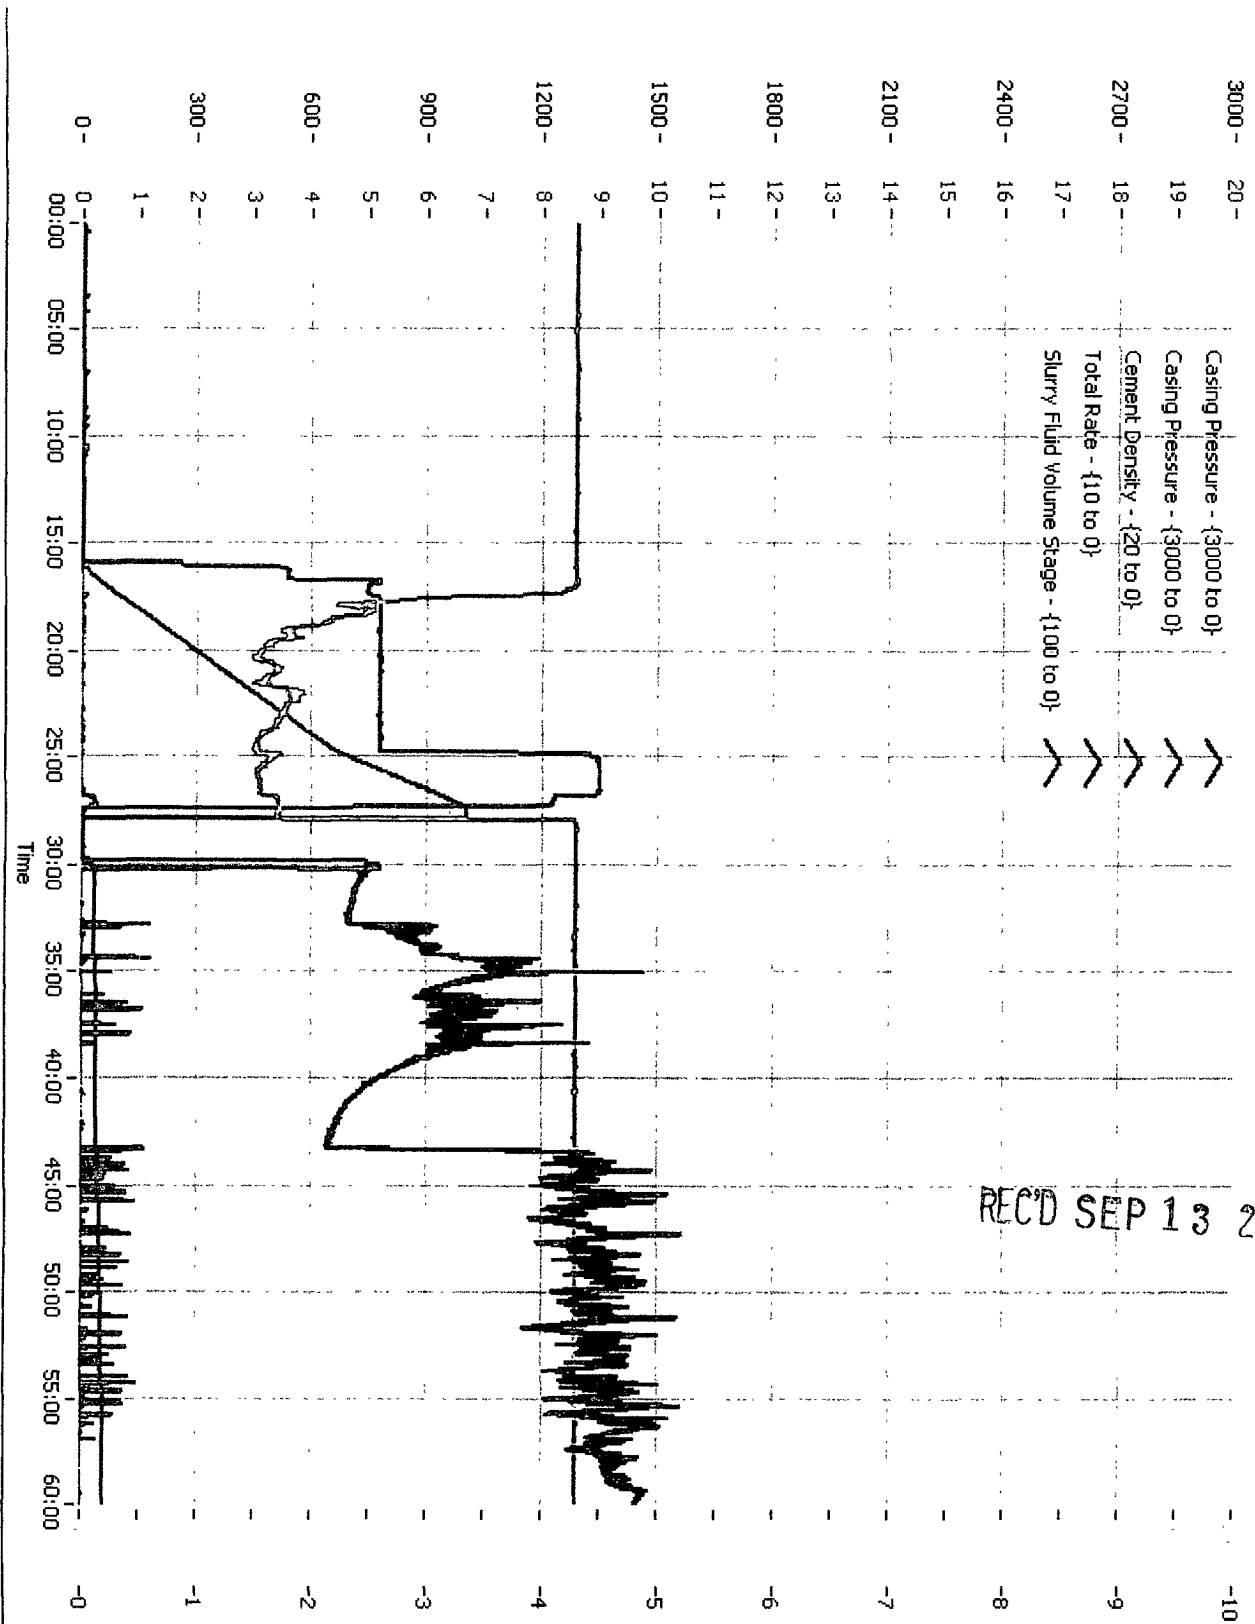

REC'D SEP 13 2008

{2}PLUG TO ABANDON - Relative Time Chart [36-001050-03-2-RT-1]

Friday, August 22, 2008



BREAK THROUGH

RCVD OCT 13 '09
OIL COMS. DIV.
051.3