
0+4 (BLM); 1-Crystal; 1-Earleen Distribution: FORM APPROVED Form 3160-5 UNITED STATES Budget Bureau No. 1004-0135 (June 1990) DEPARTMENT OF THE INTERIOR Expires: March 31, 1993 5. Lease Designation and Serial No. BUREAU OF LAND MANAGEMENT NO-G-9208-1236 SUNDRY NOTICES AND REPORTS ON WELLS 6. If Indian, Allottee or Tribe Name Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals Navajo Allotted 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE 1. Type of Well Oil Well 8. Weil Name and No. X Gas Well Chaco Wash No. 1 Name of Operato Merrion Oil & Gas Corporation 9. API Well No. 30-031-20975 3. Address and Telephone No. P. O. Box 840, Farmington, New Mexico 87499 (505) 327-9801 10. Field and Pool, or Exploratory Area **Undesignated Gallup** 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State **McKinley** 1820' FSL & 1850' FEL **New Mexico** Section 13, T20N, R6W CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA 12. TYPE OF ACTION TYPE OF SUBMISSION X Notice of Intent Change of Plans Abandonment New Construction Recompletion Non-Routine Fracturing ___ Subsequent Report Plugging Back Water Shut-Off Casing Repair Conversion to Injection Altering Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* Merrion proposes to P&A this wellbore for lack of commercial quantities of natural gas as follows: 1. Comply to all NMOCD, BLM and Merrion safety rules and regulations. 2. MOL and RU Service Unit. Blow well down; kill with water if necessary. ND WH and NU BOP and stripping head; test BOP. POH and tally 2-3/8" EUE tubing (3807'). Ŋ 3. Plug #1 (Gallup perfs): RIH with open-ended tubing and tag bottom or to 3910'. Mix 150 sxs Class-B cement and spot a balance plug over the Gallup perfs (50% excess, long plug). POH and WOC. RIH and tag cement. Load well with water; circulate clean then pressure test casing to 500#. 4. Plug #2 (MV top): POH to 1450'. Mix 37 sxs Class B cement and spot balance plug from 1450' to 1300'.

POH and LD tubing.

CONTINUED ON OTHER SIDE

4. I hereby certify that the foregoing is true	nd correct			
Signed Signed	\ li	Title	Operations Manager	Date4/4/94
				A
(This space for Peters of State office use)				APPROVED
		_		AS AMENDED
Approved by		Title		Died O Talal and Alexander
Conditions of approval, if any:				

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any or representations as to any matter within its jurisdiction

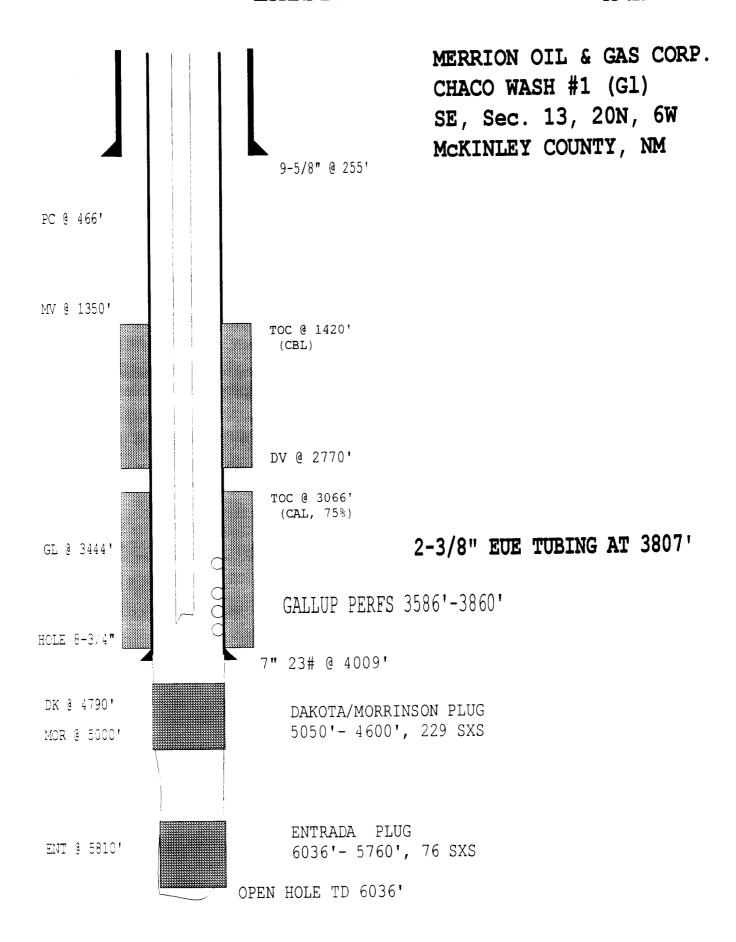

PLUGGED WELL

