

CHACE OIL COMPANY, INC.



Albuquerque, New Mexico 87108

(505) 266-5562

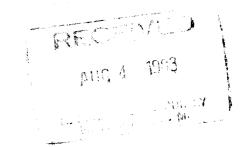

WELL HISTORY

Name:

Chace Oil Company, Inc. Jicarilla Apache 71-12

Location:

Unit 'C' - 710' FNL & 2015' FWL

Section 10, T23N,R4W

Rio Arriba County, New Mexico

Elevation:

7305' GL

Projected Depth:

7600'

Estimated Formation Tops:

Ојо	2580 '
Pictured Cliffs	30251
Chacra	3375'
Cliff House	4560'
Point Lookout	5090'
Gallup	6185'
Tocito	6845'
Greenhorn	7165'
Dakota 'A'	7250 '
Dakota 'D'	7390 '
Burro Canyon	7495'

1/12/83:

APD submitted.

5/10/83:

APD approved.

7/17/73:

Road and pad construction commenced.

7/30/83:

Spudded with Arapahoe Drilling Company @ 1:30 P. M. Ran 5 joints of 8 5/8" 24# J55. 202', set @ 215' KB. Cemented with 177 sks (208 CF) Class B neat cement, 3% Kcl, $\frac{1}{4}$ lb/sk Flocele. Circulated 3 bbls. to surface. Plug down @ 6:15 P. M.



UNITED STATES

UNITED STATES	5. LEASE
DEPARTMENT OF THE INTERIOR	Tribal Contract #71
GEOLOGICAL SURVEY	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
	Jicarilla Apache
SUNDRY NOTICES AND REPORTS ON WELLS	7. UNIT AGREEMENT NAME
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9–331–C for such proposals.)	0. 5404.00 15405 NAME
reservoir. Use runni 3-332 o 181 30011 proposation	8. FARM OR LEASE NAME
1. oil gas other	Jicarilla Tribal Contract #71 9. WELL NO.
2. NAME OF OPERATOR	/11/12
Chace Oil Company, Inc.	10. FIELD OR WILDCAT NAME
3. ADDRESS OF OPERATOR	S. Lindrith Gallup Dakota
313 Washington, SE, Albuquerque, NM 87108	11. SEC., T., R., M., OR BLK. AND SURVEY OR
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17	AREA
below.) Unit 'C', 710' FNL & 2015' FWL	Section 10, T23N,R4W 12. COUNTY OR PARISH 13. STATE
AT TOP PROD. INTERVAL:	Rio Arriba New Mexico
AT TOTAL DEPTH:	14. API NO.
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE,	
REPORT, OR OTHER DATA	15. ELEVATIONS (SHOW DF, KDB, AND WD)
	7305' GL
REQUEST FOR APPROVAL TO: SUBSEQUENT REPORT OF:	The state of the s
TEST WATER SHUT-OFF FRACTURE TREAT	THE CHANGE WITE TO
SHOOT OR ACIDIZE	
REPAIR WELL	(NOTE: Report results of multiple completion or zone change on completion or zone
PULL OR ALTER CASING	AUS 8 - 1483
CHANGE ZONES	15.Y
ABANDON* FARMANDA	OIL COLUMN
Spud	DIST. 3
17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly statincluding estimated date of starting any proposed work. If well is described in the complete of the	e all pertinent details, and give pertinent dates,
measured and true vertical depths for all markers and zones pertined	nt to this work.)*
7/30/83: Spudded with Arapahoe Drilling Compa	ny @ 1:30 P. M.
Ran 5 joints of 8 5/8" 24# J55. 202	
Cemented with 177 sks (208 CF) Class	
3% Kcl, ½ lb/sk Flocele. Circulated	3 bbls. to
surface. Plug down @ 6:15 P. M.	
Subsurface Safety Valve: Manu. and Type	Set @Ft.
18. I hereby certify that the foregoing is true and correct	
	date August 1, 1983
(This space for Federal or State of	fice use)

AUG 0-4-1983

FAROLIEGISM RETOURDS AGEA FORMMENT ON LAND INFORM

*See Instructions on Reverse Side

Section 2007 1 1 Part # 3 DATE