

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
2. NAME OF OPERATOR Aztec Oil & Gas Company		7. UNIT AGREEMENT NAME Jicarilla Contract #125	
3. ADDRESS OF OPERATOR P. O. Drawer 570, Farmington, New Mexico		8. FARM OR LEASE NAME Arizona Jicarilla	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 815 FSL & 1115 FEL, Section 36-25N-4W		9. WELL NO. #6	
14. PERMIT NO.		15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7213 Gr	
		10. FIELD AND POOL, OR WILDCAT South Blanco Picture Cliff	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 36-25N-4W	
		12. COUNTY OR PARISH Rio Arriba	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1-24-71 Moved in & rigged up. Killed well. Installed Blow Out Preventor. Tagged bottom. Tally out of hole. Rigged up McCullough. Set Bridge Plug at 3480'. Went in hole with packer. Pressure test casing to 1500# - Held Ok. Pulled out with packer. Went in with bit. Drilled out Bridge Plug at 3480'.

1-25-71 Finished drilling out Bridge Plug. Cleaned out to TD 3565'. Tripped tubing. Ran 119 joints 2-3/8" 4.7# EUE tubing landed at 3520'. Started swabbing. Fluid down 2500' from surface.

1-26-71 Kicked well off. Blowing to clean. Rigged down.

1-27-71 Placed On Production.

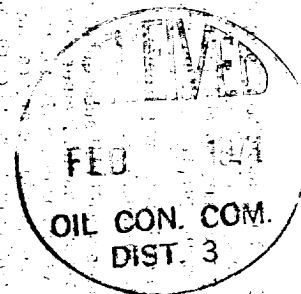

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE District Superintendent

DATE January 27, 1971

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: