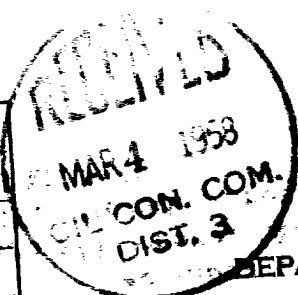
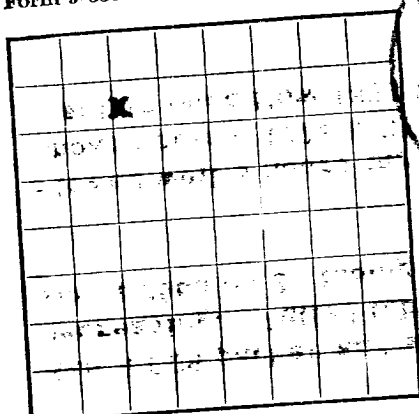


U. S. LAND OFFICE **Santa Fe**
SERIAL NUMBER **NM 03756**
LEASE OR PERMIT TO PROSPECTUNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

LOG OF OIL OR GAS WELL

LOCATE WELL CORRECTLY

Company **San Juan Gas Corporation** Address **300 Shell Building, Tulsa, Oklahoma**
Lessor or Tract _____ Field **W.C.** State **New Mexico**
Well No. **10-C** Sec. **10** T. **25N** R. **3W** Meridian **N.M.P.M.** County **Rio Arriba** Section **10** Elevation **7449**
Location **835** ft. **N** of **N** Line and **850** ft. **W** of **W** Line of _____ (Derrick floor relative to sea level)The information given herewith is a complete and correct record of the well and all work done thereon
so far as can be determined from all available records.
Signed **Robert C. Pearson** Title **Vice Pres**Date **Feb 27, 1958**The summary on this page is for the condition of the well at above date.
Commenced drilling **August 20**, 19 **57** Finished drilling **August 25**, 19 **57**OIL OR GAS SANDS OR ZONES
(Denote gas by G)No. 1, from **3648** to **3712 (G)** No. 4, from _____ to _____
No. 2, from _____ to _____ No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from **0** to **300** No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From	To	
10 3/4		8	CPI	65					Surface
5 1/2 14		8	CPI	3732	Halliburton		(3648)	(3648)	Production
							(3678)	(3678)	
							(3695)	(3712)	

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
10 3/4	75	100			
5 1/2	3730	150	Halliburton 2 plug		

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out

TOOLS USED

Rotary tools were used from **0** feet to **3730** feet, and from _____ feet to _____ feet
Cable tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet

DATES

Put to producing _____, 19____
The production for the first 24 hours was _____ barrels of fluid of which _____% was oil; _____%
emulsion; _____% water; and _____% sediment. Gravity, °Bé. _____
If gas well, cu. ft. per 24 hours **1893 MCF** Gallons gasoline per 1,000 cu. ft. of gas _____
Rock pressure, lbs. per sq. in. _____

EMPLOYEES

_____, Driller _____, Driller
_____, Driller _____, Driller

FORMATION RECORD

FORMATION		TOTAL FEET	FORMATION
FROM—	TO—		
0	450	450	Sand with shale
450	620	170	Shale with broken sand
620	860	240	Sand with shale
860	1040	180	Sable and broken sand
1040	1205	165	Sand
1205	1275	70	Shale with broken sand
1275	1875	600	Sand
1875	2040	165	Shale
2040	2950	910	Sand and shale
2950	3175	225	Shale and sand
3175	3375	200	Sand and shale
3375	3520	145	Sand
3520	3634	114	Shale, sand and coal
3634	3712	78	Sand and shaly sand
3712	3730	18	Shale

3375 Ojo Alamo)
3520 Fruitland) E.L.
3634 Pictured)
Cliffs

September 10 - September 12, 1937

Y. J. Chen et al.

September 7, 1957

micro. C. 1000
part soil 2561-1

महाराष्ट्र राज्य

Continued on comment to 3728

W.O.C. and packer W.O.C.

Aug. Perf. @ 3636 with 1.47
August 28 - August 28, 1957

It is of the greatest importance to have a complete history of the well. Please state in detail the dates of redrilling, together with the reasons for the work and its results. If there were any changes made in the casing, state fully, and if any casing was "sidetracked" or left in the well, give its size and location. If the well has been dynamited, give date, size, position, and number of shots. If plugs or bridges were put in to test for water, state kind of material used, position, and results of pumping or balling. Spud August 20, 1957. Cemented 5 1/2 cas. @ 4230. Cemented 10 3/4 August 20, 1957 @ 4710.

U. S. GOVERNMENT PRINTING OFFICE
16-43064-2

U. S. GOVERNMENT PRINTING OFFICE

FORMATION RECORD-Continued