

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole	5. LEASE DESIGNATION AND SERIAL NO. Jicarilla Contract 147
2. NAME OF OPERATOR PAN AMERICAN PETROLEUM CORPORATION	6. IF INDIAN, ALLOTTEE OR TRIBE NAME Jicarilla Apache
3. ADDRESS OF OPERATOR 501 Airport Drive, Farmington, New Mexico 87401	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 820' FWL & 1100' FWL	8. FARM OR LEASE NAME Jicarilla Contract 147
14. PERMIT NO.	9. WELL NO. 5
15. ELEVATIONS (Show whether DF, RT, GR, etc.) GL 6704', RDS 6718'	10. FIELD AND POOL, OR WILDCAT Basin Dakota
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA NK/4 Section 7, T-23-N, R-3-W
	12. COUNTY OR PARISH Rio Arriba
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


☐
☐
☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

As a result of failing to find oil or gas in commercial quantities, we plugged and abandoned the Jicarilla Contract 147 No. 5 on October 30, 1970 as follows:

1. Spotted 100 sacks from 6789-7189'.
2. Spotted 50 sacks 5099-5299'.
3. Spotted 50 sacks 4400-4600'.
4. Spotted 50 sacks 3611-3811'.
5. Spotted 50 sacks 2753-2953'.
6. Spotted 100 sacks 2096-2496'.
7. Spotted 150 sacks 200-547'.
8. Spotted 10 sacks surface-61'.
9. Loaded hole with mud between plugs.
10. Set dry hole marker and cleaned up location for inspection.

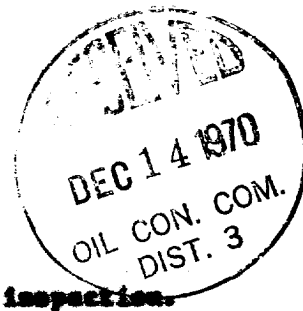

RECEIVED

1970

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Area Engineer

DATE

December 10, 1970

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

St

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.