

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. 03623
2. NAME OF OPERATOR Skelly Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR 1360 Lincoln Street, Denver, Colorado 80203		7. UNIT AGREEMENT NAME East Bisti Unit
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FNL and 660' FEL Section 11-24N-10W		8. FARM OR LEASE NAME
14. PERMIT NO.		9. WELL NO. 105
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6941' DF 6945' GR		10. FIELD AND POOL, OR WILDCAT Bisti Lower Gallup
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 11-24N-10W
		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico


16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

All depths shown are from ground level.
6-11-71 - MI & RU Aztec Well Service Unit. Pulled rods and tubing.
Spotted cement plug from 5527' to 5427'.
Worked 5-1/2" casing and shot off casing at 1671'. Pulled 40 joints 5-1/2" casing 1671'.
Spotted cement plug from 1902' to 1752'. Cement plug from 1721' to 1621'.
50' inside and 50' outside of 5-1/2" casing stub. Cement plug from 1157' to 1057'.
Spotted 10' cement plug in surface casing. Installed dry hole marker.
Completed P & A 6-23-71.

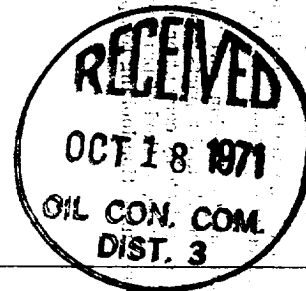

18. I hereby certify that the foregoing is true and correct

SIGNED L. L. Bille TITLE Lead Clerk DATE 10-15-71

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: