

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER	5. LEASE DESIGNATION AND SERIAL NO. Contrast #100
2. NAME OF OPERATOR Southern Union Production Company	6. IF INDIAN, ALLOTTEE OR TRIBE NAME Jicarilla Apache Tribe of Indians
3. ADDRESS OF OPERATOR P. O. Box 808 - Farmington, New Mexico	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1190 ft. from the South line and 1850 ft. from the West line.	8. FARM OR LEASE NAME Jicarilla D
14. PERMIT NO.	9. WELL NO. 9
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7250 ft. D.F.	10. FIELD AND POOL, OR WILDCAT Tapacito Pictured Cliffs
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 31, T-26N, R-3W N.M.P.M.
	12. COUNTY OR PARISH Rio Arriba
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other) ☒


REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

Supplementary History

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Drilled 7-7/8" hole with mud to total depth of 3950 ft. D.F.
2. Ran 128 jts. 5-1/2", 15.50#, J-55 casing. Landed at 3949 ft. D.F. Cemented with 150 sacks regular cement containing 12-1/2# gilsonite/sack and 2% gel. Plug down 5:00 A.M. July 3, 1965. Ran 155 bbl. of Ken-Pac ahead of cement. Ken-Pac circulated to surface.
3. Pressure tested casing to 3500 psi for 15 minutes on July 12, 1965. Test OK. Perforated 1 shot/ft. from 3811 - 3842 ft.
4. Sand Water and Carbon Dioxide frac perfs. w/60,000# 10-20 mesh sand and 65,352 gallons of water. Used 30 tons of liquid carbon dioxide.
5. Ran 115 jts. of 1-1/2", 2.75#, Non-Upset JCW tubing. Landed at 3830 ft. R.K.B.
6. Completed well July 14, 1965.

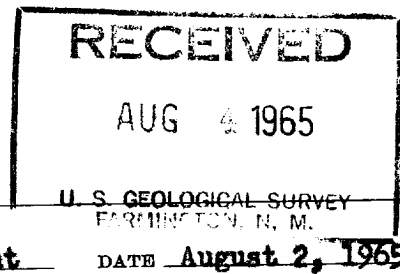

18. I hereby certify that the foregoing is true and correct

SIGNED **Gilbert D. Noland, Jr.**

TITLE **Drilling Superintendent**

DATE **August 2, 1965**

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.