

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on reverse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER		5. LEASE DESIGNATION AND SERIAL NO. Jicarilla Cont. 108
2. NAME OF OPERATOR Tenneco Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 1714, Durango, Colorado 81301		7. UNIT AGREEMENT NAME Jicarilla Dulce, N. M.
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1650' FSL, 990' FSL		8. FARM OR LEASE NAME Jicarilla "C"
14. PERMIT NO.		9. WELL NO. No. 3
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6574 GR		10. FIELD AND POOL, OR WILDCAT Undersig. Gallup & Basin Dakota
		11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA Section 23, T26N, R5W
		12. COUNTY OR PARISH Rio Arriba
		13. STATE New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7/17/66 rig up, drill out stage collars 3203' and 5492'. Clean out to TD. Perf 7501, 7504, 7493, 7497, 7442, 7449'. Frac with 85,000 gals water and 65,000# sand. Set bridge plug at 7430'. Perf 7410-15', 7403-07', 7301-03', 7288-91'. Frac with 55,000# sand and 75,000 gals water. Perf 6772-62', 6758-62', 6750-54'. Frac with 60,000# sand and 60,000 gals water. Bridge plug set at 6800'. Clean out to 7572' PSTD. Set production packer at 7230'. Landed 2-1/16" tubing in packer. Set parallel string anchor at 6703' and ran 2-1/16" tubing set in anchor at 6703'. Released 7/17/66. Waiting on tests.

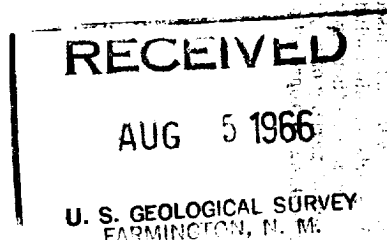

18. I hereby certify that the foregoing is true and correct

Original Signed By

SIGNED HAROLD C. NICHOLSTITLE Senior Production ClerkDATE 8/4/66

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Distribution:

6 - USGS, Farmington

1 - Continental, Atlantic *See Instructions on Reverse Side

1 - File

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; and or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking for approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685219

987-951

