

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

Jicarilla Apache 102

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Jicarilla Apache 102

9. WELL NO.

29

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND

SURVEY OR AREA

SW/4 NE/4 Section 9,

T-26-N, R-4-W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

NM

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL ☐ WELL GAS ☒ WELL OTHER ☐
2. NAME OF OPERATOR
AMSCO PRODUCTION COMPANY
3. ADDRESS OF OPERATOR
501 Airport Drive Farmington, NM 87401
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1560' FNL x 1790' FNL, Section 9, T-26-N, R-4-W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7139' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:


WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐Spud & Set Casing ☒(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spudded 13-3/4" hole 1/6/78. Drilled to 288'. Set 9-5/8" 32.3# casing at 284' with 300 sx Class "B", 2% CaCl₂. Circulated 15 sx good cement. Pressure tested 500 psi for 30 minutes; held OK.

Drilled 8-3/4" hole to 4250'. Set 7 20# casing at 4250' with 440 sx Class "B", 6% gel, 2 lbs. Tuf Plug per sx. Circulated out 2 sx good cement. Pressure tested to 1000 psi for 30 minutes; held OK.

Drilled 6-1/4" hole to a total depth of 6250'. Ran 4-1/2" 10.5# casing liner 4032-6249'. Cemented with 140 sx Class "B", 6% gel, 2 lbs. Tuf Plug per sx. Tailed in with 100 sx Class "B", 6% gel. Reversed out 15 sx good cement.

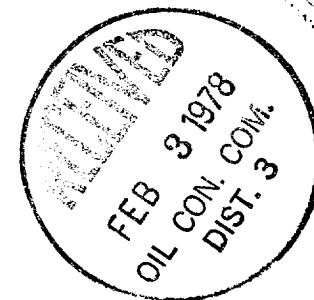

18. I hereby certify that the foregoing is true and correct

SIGNED

E. E. Svoboda

TITLE

Area Adm. Supervisor

DATE

1/31/78

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

DATE

RECEIVED

FEB 1 1978

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
DURANGO, COLO.

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.