
CORRECTED REPORT REVISED 1-1/2" TUBING DEPTH

SOUTHLAND ROYALTY COMPANY

Jicarilla 101 #7
1050' FSL & 1180' FEL
Section 12, T26N, R4W
Rio Arriba, New Mexico

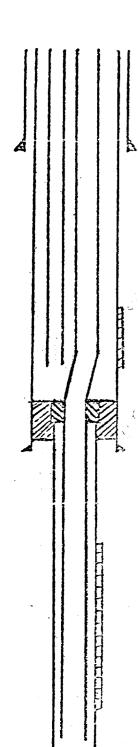

10-3/4", 30#, Genesco casing set at 237'. Cemented with 140 sxs Class B

Perforated Pictured Cliffs from 5781'-5972' with total of 12 holes.
1-1/2", 2.76# & 2.90#, CSR-55, IJ set at 6029'.
5-1/2" liner hanger hung @ 3774'.
Model "F" packer set at 6105'.

7-5/8", 26.40#, N-80 casing set at 3920'. Cemented with 430 sxs Class B.

Dakota perforated from 7807'-7997' with total of 11 holes.



2-1/16", 3.25#, CSR-55, IJ set at 7978'.

5-1/2", 17# and 15.5#, K-55 liner set from 3774'-8007'. Cemented with 415 sxs Class B.