

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
TO THE DISTRICT OFFICE OF THE
GEOLOGICAL SURVEY

Form approved
District Office No. 42 R1121
LEASE DESIGNATION AND LEASE NO.
079958
G. IF INDIAN, ALLOTTEE OR TRUST NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for a well that is to be drilled or to drill on or plug back to a different reservoir.
See CAPTIONED FOR FIRST OF TWO (1) OF TWO)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME East Bisti Unit	
2. NAME OF OPERATOR Skelly Oil Company		8. FARM OR LEASE NAME	
3. ADDRESS OF OPERATOR 1860 Lincoln Street - Denver, Colorado 80203		9. WELL NO. 49	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FSL and 1980' FEL Section 28-25N-10W		10. FIELD AND POOL, OR WILDCAT Bisto Lower Gallup	
11. SEC. 1, 2, 3, 4, OR BLK. AND SURVEY OR AREA Section 28-25N-10W		12. COUNTY OR PARISH San Juan	
13. STATE New Mexico		14. PERMIT NO. 6749' Gr	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT ON:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and notes pertinent to this work.) *

All depths shown are from Ground Level.

9/21/71 - MI&RU Aztec Well Service Unit. Pulled rods.
Spotted cement plug from 5397' to 5297'. Pulled 2" tubing.
Worked 5 1/2" casing to free same. Rigged up Blue Jet, perforated from 1740' to 1739' w/4 shots. Ran 2" tubing, spotted cement plug from 1740' to 1590'.
Pulled tubing. Shot 5 1/2" casing off at 1194'. Spotted cement plug from 1244' to 1144' 50' inside casing and 50' above 5 1/2" casing stub.
Spotted cement plug from 1000' to 900'.
Pulled total 37 joints 1212' of 5 1/2" casing.
Spotted 10' cement plug in surface casing. Installed dry hole marker.
Completed P&A 9/21/71.

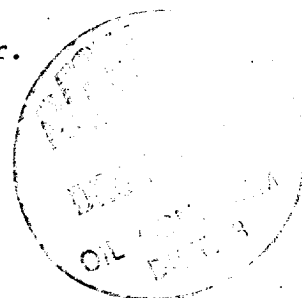

18. I hereby certify that the foregoing is true and correct

SIGNED Lo. L. Byle TITLE Lead Clerk DATE December 15, 1971.

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: