

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. 14-20-603-1366	
2. NAME OF OPERATOR Skelly Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Navajo	
3. ADDRESS OF OPERATOR 1850 Lincoln Street, Denver, Colorado 80203		7. UNIT AGREEMENT NAME East Bisti Unit	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FNL and 1890' FEL Section 30-25N-10W		8. FARM OR LEASE NAME	
14. PERMIT NO.		9. WELL NO. 35	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6577' GR		10. FIELD AND POOL, OR WILDCAT Bisti Lower Gallup	
		11. SEC., T., R., M., OR BLE. AND SURVEY OR AREA Section 30-25N-10W	
		12. COUNTY OR PARISH San Juan	
		13. STATE New Mexico	


16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

All depths shown are from ground level.
7-16-71 - MI & RU Aztec Well Service Unit. Pulled all rods.
Spotted cement plug from 5147' to 5047'. Pulled 2" tubing.
Worked 4-1/2" casing to free same. Shot casing at 3007', 2543', 2473', unable to pull free. Shot 5-1/2" casing at 2028', casing pulled free. Spotted cement plug from 2078' to 1978', 50' inside casing and 50' above casing stub.
Pulled casing to 1540'. Spotted cement plug from 1540' to 1390', pulled casing to 760'.
Spotted cement plug from 760' to 660'.
Pulled total of 64 joints, 2042' of 4-1/2" casing.
Spotted 10' cement plug in surface casing. Installed dry hole marker.
Completed P & A 7-23-71.

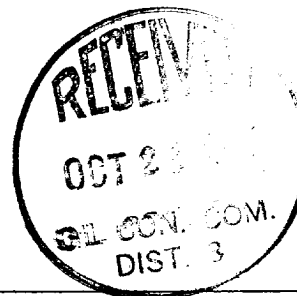

18. I hereby certify that the foregoing is true and correct

SIGNED C. J. Bill TITLE Lead Clerk DATE 10-20-71

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: