Form 3160-5 (June 1990)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED Budget Bureau No. 1004-0135

Expires: March 31, 1993

5. Lease Designation and Serial No.

6. If Indian, Allottee or Tribe Name

Non-Routine Fracturing

Conversion to Injection

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

Water Shut-Off

Dispose Water

SF 078056

SUNDRY NOTICE	S AND	REPORTS	ON	WELLS
---------------	-------	---------	----	-------

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE Central Bisti Unit 1. Type of Well 8. Well Name and No. Oil Well X Other Water Injection Well Central Bisti Unit #WI-21 2. Name of Operator 9. API Well No. Giant Exploration & Production Company 30-045-05485 3. Address and Telephone No. 10. Field and Pool, or Exploratory Area 87499 (505) 326-3325 PO Box 2810, Farmington, N.M. Bisti Lower Gallup 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 1980' FNL, 660' FWL, Sec. 7, T25N, R12W San Juan, New Mexico CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA 12. TYPE OF ACTION TYPE OF SUBMISSION Notice of Intent Change of Plans Abandonment New Construction Recompletion

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Other

Plugging Back


Casing Repair

Altering Casing

Please see Attachment "A".

Subsequent Report

Final Abandonment Notice

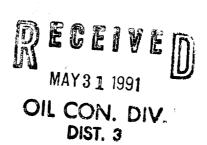

4. I hereby certify that the foregoing is true and correct Signed President	
(This space for Federal or State office use)  Approved by	Date MAY 24 1991

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

## Giant Exploration & Production Company Central Bisti Unit #21 WI Attachment "A"

Giant Exploration & Production Co. plans to plug and abandon the above location as follows:

- Move on location. Circulate wellbore through 2-3/8" tubing string.
- 2. Set cement retainer at 4860' and pump 25 sacks (29.5 cuft) Class "B" cement into Lower Gallup perforations from 4880'- 4886'. A 35 sack (41.3 cuft) cement plug will then be spotted above the retainer inside the 5-1/2", 15.5#, casing interval 4860'- 4659'.
- 3. Perforate 2 squeeze holes at 2660'.
- 4. Spot 30 sacks (35.4 cuft) cement plug to cover the top of the Mesa Verde formation from 2660' to 2560'. Pressure displace 15 sacks into the perforations at 2660'.
- 5. Perforate 2 squeeze holes at 1610'.
- 6. Spot 30 sacks (35.4 cuft) cement plug to cover the top of the Chacra formation from 1610' to 1510'. Pressure displace 15 sacks into the perforations at 1610'.
- 7. Spot 15 sacks (17.7 cuft) cement plug to cover the top of the Pictured Cliffs formation from 1310' to 1210'.
- 8. Spot 15 sacks (17.7 cuft) cement plug to cover the top of the Fruitland Coal formation from 930' to 830'.
- 9. Perforate 4 squeeze holes at 520' to allow coverage of the Ojo Alamo formation from 520' to surface. Circulate 200 sacks (236 cuft) of cement from 520' to surface leaving both the inside and outside of the casing full of cement.
- 10. Cut off the wellhead and install the dry hole marker.

# UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT
FARMINGTON RESOURCE AREA
1235 LA PLATA HIGHWAY
FARMINGTON, NEW MEXICO 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: NF-2F Central B. 37

#### CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal Leases."
- 2. Muk Kally with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 326-6201.
- 3. Blowout prevention equipment is required.
- 4. The following modifications to your plugging program are to be made (when applicable):

Bring Gallup plug up to 4459

Office Hours: 7:45 a.m. to 4:30 p.m.

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON RESOURCE AREA

and the second of the second o

- 1. Secure prior approval either on a Sundry Notice (Form 3160-5) or verbally from the Fluids Drilling & Production Section at this office before changing the approved plugging program.
- 2. Plugging equipment used shall have separate mixing and displacement pumps and a calibrated tank to assure proper displacement of plugs. The Operator is responsible for providing all measuring devices needed to assure proper measurement of materials being used.
- 3. A proper tank or pit will be used to contain all fluids pumped from the well during plugging operations. Unattended pits are to be fenced.
- 4. All cement plugs are to be placed through tubing (or drillpipe) and shall be a minimum of 100 feet in length with 50% excess inside casing or 100% excess when plug is set in open hole or squeezed into perforations. 15.6#/gal slurry weight is to be used when using class B neat cement or when CaCl<sub>2</sub> is used. Use the recommended slurry weight of other type cements when they are used (Class C, Pozzolan etc.).
- 5. Any cement plugs placed when well is not full of fluid, or when well may be taking fluid, (i.e. across perfs-unless bridge plug or retainer is used, across bad csg., or fresh water formations) will be tagged (touched) after cement has set to verify proper location.
  - 5a. Testing The first plug below the surface plug shall generally be tested by either tagging the plug with the working pipe string, or pressuring to a minimum pump (surface) pressure of 1000 psig, with no more than a 10 percent drop during a 15-minute period (cased hole only). If the integrity of any other plug is questioned, it must be tested in the same manner. Also, any cement plug which is the only isolating medium for a fresh water interval or a zone containing a valuable mineral deposit should be tested by tagging with the drill string.
- 6. Mud must be placed between plugs. Plugging mud is to be made up with a minimum of 15 lbs/bbl of sodium bentonite, and a nonfermenting polymer.

  Minimum consistency of plugging mud must be 9 lbs/gal and with a minimum viscosity of 50 sec/qt. Fresh water is to be utilized for mixing mud.
- 7. Following the placement of a cement plug, the withdrawl rate for at least the length of the cement plug shall not exceed 30 ft/min, in order to minimize the contamination of the plug.

الرس الله الذي الله الذي الله الذي السيط المستعدد . المهارة الله الذي الله المستعدد .

i garualgibbo qom 🗀

- 8. Within 30 days after plugging work is completed, file a Sundry Notice (Subsequent Report of Abandonment, Form 3160-5), in quintuplicate with Area Manager, Bureau of Land Management, 1235 La Plata Highway, Farmington, NM 87401. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 9. All permanently abandoned wells are to be marked with a regulation marker (4" pipe extending 4' above the ground line) containing the information as the specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10. After plugging work is completed the surface is to be rehabilitated in accord with instructions from the Fluids Surface Management Section of the Farmington Resource Area Office.

All above are minimum requirements. The period of liability under the bond of record will not be terminated until the lease is inspected and surface work approved.

Please advise this office when the well location is ready for final inspection.

Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to:43 CFR 3163.1.

You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.